

13585 N.E. Whitaker Way • Portland, OR 97230 Phone (503)255-5050 • Fax (503)255-0505 www.horizonengineering.com

Project No. 3472

Permit No. 11656

SOURCE EVALUATION REPORT

Saint-Gobain Containers, Inc. Seattle, Washington

Glass Melting Furnace No. 5
Cloud Chamber Inlet
Total Chrome

March 11, 2010

Test Site:
Saint-Gobain Containers, Inc.
5801 East Marginal Way S.
Seattle, Washington 98134

TABLE OF CONTENTS

1.	CERTIFICATION	Page Number 4
2.	INTRODUCTION	5
3.	SUMMARY OF RESULTS	6
4.	SOURCE DESCRIPTION AND OPERATION	8
5.	SAMPLING AND ANALYTICAL PROCEDURES	9
6.	DISCUSSION	11

APPENDIX	Page Number
Abbreviations & Acronyms	12
Nomenclature	14
Total Chrome	
Total Chrome and Flow Rate Results	15
Example Calculations	17
Field Data	22
Sample Recovery Field Data and Worksheets	27
Laboratory Results and COC	29
Traverse Point Locations	44
Tedlar Bag Field Data and Analyzer Calibration Data	46
Production/Process Data	
Furnace Operating Data	47
Calibration Information	
Meter Box	48
Calibration Critical Orifices	51
Standard Meter	52
Pitots	53
Thermocouples and Indicators	54
Nozzle Diameters	61
Barometer	62
Calibration Gas Certificates	63
QA/QC Documentation	
Procedures	67
Analyzer Interference Response Data	70
Correspondence	
Source Test Plan and Correspondence	72
Permit (Selected Pages)	79

1. CERTIFICATION

1.1 Test Team Leader

I hereby certify that the test detailed in this report, to the best of my knowledge, was accomplished in conformance with applicable rules and good practices. The results submitted herein are accurate and true to the best of my knowledge.

Name: Preston Skaggs

Signature

____ Date <u>800 04 13</u>

1.2 Report Review

I hereby certify that I have reviewed this report and find it to be true and accurate, and in conformance with applicable rules and good practices, to the best of my knowledge.

Name: David Bagwell, QSTI

Signature

pate 4/18/10

1.3 Report Review

I hereby certify that I have reviewed this report and find it to be true and accurate, and in conformance with applicable rules and good practices, to the best of my knowledge.

Name: Michael E. Wallace, PE

Signature

Walle Date 4/19/10

2. INTRODUCTION

2.1 Test Site: Saint-Gobain Containers, Inc.

5801 East Marginal Way S. Seattle, Washington 98134

2.2 Mailing Address:

1509 S. Macedonia Avenue

P.O. Box 4200

Muncie, IN 47307-4200

2.3 Test Log:

Glass Melting Furnace No. 5, Cloud Chamber Inlet: Total Chrome

Test Date	Run No.	Test Time
March 11, 2010	1	08:25 - 10:28
11	2	10:50 - 13:57
11	3	14:10 – 17:16

Summary: One valid 120-minute run (Run 1) and two valid 180-minute runs (Runs 2 and 3).

2.4 Test Purpose: To demonstrate compliance with the National Emission Standard for Hazardous Air Pollutants for Glass Manufacturing Area Sources, <u>40 CFR Part 63</u>, Subpart SSSSS for affected sources.

2.5 Background Information: None

2.6 Participants:

Horizon Personnel:

Preston Skaggs, Team Leader

Neil A. Young, Field Technician

Michael E. Wallace, PE, Calculations and QA/QC

David Bagwell, QSTI, Report Review

Christopher D. Lovett, Technical Writer

Test Arranged by: Jayne Browning, Saint-Gobain Containers, Inc.

Observers:

Plant Personnel: Marlon Trigg, Saint-Gobain Containers, Inc.

Agency Personnel: Gerry Pade, PSCAA

Test Plan Sent to:

PSCAA: Gerry Pade

USEPA Region 10: Madonna Narvaez

3.13

3. SUMMARY OF RESULTS

Glass Pull Rate

3.1 Table of Results:

Table 1
Furnace No. 5, Cloud Chamber Inlet – Total Chrome Test Results

Test Date: March 11, 2010 Units Sampling Results Run 1 Run 2 Run 3 Average Start Time 08:25 10:50 14:10 End Time 10:28 13:57 17:16 160 Sampling Time minutes 120 180 180 Sampling Results **Total Chrome** Concentration 631 653 645 643 µg/dscm Rate 0.022 0.022 0.021 0.022 lb/hr Production-Based lb/ton 0.0070 0.0071 0.0068 0.0070 Subpart SSSSS Limit lb/ton 0.02 82.4 86.8 74.8 Sample Volume 55.2 dscf 2.1 Sample Volume 1.6 2.3 2.5 dscm Percent Isokinetic 93 95 % 91 101 Sample Weight, Total 986 1523 1586 1365 μg 19.1 % 19.0 19.2 19.0 O_2 3.8 3.5 CO_2 % 3.6 3.0 Source Parameters Flow Rate (Actual) 16,900 16,000 16,000 16,300 acf/min Flow Rate (Standard) dscf/min 9,330 9,150 8,850 9,110 °F Temperature 408 379 399 395 Moisture % 8.2 8.6 8.3 8.1 Process/Production Data

3.13

ton/hr

3.13

3.13

3.2 Discussion of Errors and Quality Assurance Procedures: This table is taken from a paper entitled "Significance of Errors in Stack Sampling Measurements," by R.T. Shigehara, W.F. Todd and W.S. Smith. It summarizes the maximum error expressed in percent, which may be introduced into the test procedures by equipment or instrument limitations.

Measurement	% Max Error
Stack Temperature Ts	1.4
Meter Temperature Tm	1.0
Stack Gauge Pressure Ps	0.42
Meter Gauge Pressure Pm	0.42
Atmospheric Pressure Patm	0.21
Dry Molecular Weight Md	0.42
Moisture Content Bws (Absolute)	1.1
Differential Pressure Head ΔP	10.0
Orifice Pressure Differential ΔH	5.0
Pitot Tube Coefficient Cp	2.4
Orifice Meter Coefficient Km	1.5
Diameter of Probe Nozzle Dn	0.80

3.2.1 <u>Manual Methods</u>: QA procedures outlined in the test methods were followed, including equipment specifications and operation, calibrations, sample recovery and handling, calculations and performance tolerances.

On-site quality control procedures include pre- and post-test leak checks on the sampling system and pitot lines. If pre-test checks indicate problems, the system is fixed and rechecked before starting testing. If post-test leak checks are not acceptable, the test run is voided and the run is repeated. The results of the leak checks for the test runs are on the Field Data sheets.

Thermocouples used to measure the exhaust temperature are calibrated in the field using EPA Alternate Method 11. A single-point calibration on each thermocouple system using a reference thermometer is performed.

Thermocouples must agree within ±2°F with the reference thermometer. Also, prior to use, thermocouple systems are checked for ambient temperature before heaters are started or readings are taken. Nozzles are inspected for nicks or dents and pitots are examined before and after each use to confirm that they are still aligned. The results were within allowable tolerances. Pre- and post-test calibrations on the meter boxes are included with the report along with semi-annual calibrations of critical orifices, pitots, nozzles, and thermocouples (sample box impinger outlet and oven, meter box inlet and outlet, and thermocouple indicators).

3.2.2 <u>Tedlar Bag Gas Sampling and Analysis</u>: The QA procedures from EPA Method 3/3A in <u>Title 40 CFR Part 60</u>, Appendix A, July, 2007 were followed for gas sampling and analysis. Analyzer system checks are noted on the Calibration Field Record sheet, with procedures documented in the QA/QC section of the Appendix. All calibration standards used in the testing were EPA Protocol 1. Gas certificates are in the Appendix.

4. SOURCE DESCRIPTION AND OPERATION

4.1 Process and Control Device Description and Operation:

There are four glass-melting furnaces at the Saint-Gobain plant in Seattle, Washington. Furnace No. 5 is oxy-fuel fired, with oxygen gas being used to support fuel combustion rather than ambient air. This process results in greater overall energy efficiency, improved energy transfer to the glass, and a significant reduction in NO_x emissions. The primary fuel source of Furnace No. 5 is natural gas with additional energy input from electricity delivered through electrodes immersed in the glass (electric boosting). A cloud chamber scrubber was installed to reduce pollutant emissions at the outlet of the furnace. Furnace No. 5 total chrome testing was done at the Cloud Chamber inlet.

Production records including raw materials, glass produced and fuel usage data are included in the Appendix

4.2 Test Ports:

4.2.1 Test Duct Characteristics:

Construction: Steel Shape: Circular

Size: 36 inches inside diameter

Orientation: Vertical

Flow straighteners: None

Extension: None

Cyclonic Flow: No Cyclonic flow expected

Meets EPA Method 1 Criteria: Yes

4.3 Operating Parameters: See Production/Process Data section of Appendix. Confidential batch composition information will not be included in the official report, but will be provided to PSCAA as a supplementary enclosure.

4.4 Process Startups/Shutdowns or Other Operational Changes

During Tests: Process was continuous during testing.

5. SAMPLING AND ANALYTICAL PROCEDURES

5.1 Sampling Procedures:

5.1.1 <u>Sampling and Analytical Methods</u>: Testing was in accordance with procedures and methods listed in the Source Test Plan dated March 2, 2010 (see Correspondence Section in the Appendix), including the following: EPA Methods in 40 CFR Part 60, Appendix A, July 1, 2007.

Flow Rate: EPA Methods 1 and 2 (S-type pitot traverses with EPA

Method 29)

CO₂ and O₂: EPA Method 3/3A (integrated bag samples with NDIR and

paramagnetic analyzers)

Moisture:

EPA Method 4 (incorporated with EPA Method 29)

Metals:

EPA Method 29 (isokinetic impinger technique with analysis

by ICP-OES/ICP-MS)

5.1.2 <u>Sampling Notes</u>: During the Run 1 sample recovery, the test team leader noticed that the filter was very clean and, because he was concerned about meeting the method detection limit, decided to test for 180 minutes during Runs 2 and 3. Engineer Gerry Pade of PSCAA approved this modification to the sampling time.


5.1.3 Laboratory Analysis:

Analyte Laboratory

Chrome Columbia Analytical Services, Kelso, WA

5.2 Sampling Train Diagram:

Figure 1
EPA Method 29 Chrome Sample Train Diagram

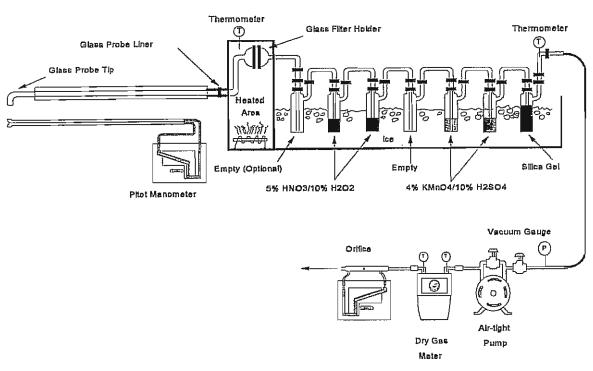

5.2.1 <u>Diagram Exceptions</u>: Impingers 4, 5 and 6 were not used (not necessary unless mercury is to be tested)

5.3 Horizon Test Equipment:

5.3.1 Manual Methods:

Equipment Name	Identification
Isokinetic Meter Box	CAE Express, Horizon No. 4
Inclined Liquid Manometer	Incorporated with meter box
Probe Liners	Borosilicate Glass

Pitots and Thermocouples 4-3, 4-7

Nozzles Quartz: Q4 & Q5

Barometer Test Van II

5.3.2 CEM Analyzers and Methods:


Gas	Brand	Model	Cal. Span	Measurement Method	Method
O_2	Servomex	1400	22.26%	Paramagnetic	3/3A
CO_2	Servomex	1400	12.38%	Chopperless NDIR	3/3A

5.3.3 Bag Sampling Setup:

Integrated Tedlar bag samples were taken from the orifice exhaust of the isokinetic meter boxes used for flow and moisture determinations. The bag contents were then analyzed using the instruments listed above.

6. DISCUSSION

The results of the testing should be valid in all respects. All quality assurance checks including leak checks, instrument checks, and calibrations, were within method-allowable tolerances.





Abbreviations and Acronyms Used in the Report

AAC Atmospheric Analysis & Consulting, Inc.

ADL Above Detection Limit

BAAQMD Bay Area Air Quality Management District
BACT Best Achievable Control Technology

BDL Below Detection Limit
BHP Boiler Horsepower

BIF Boiler and Industrial Furnace

BLS Black Liquor Solids

C Carbon C_3H_8 Propane

CAS Columbia Analytical Laboratory
CEM Continuous Emissions Monitor

CEMS Continuous Emissions Monitoring System
CERMS Continuous Emissions Rate Monitoring System

CET Calibration Error Test
CFR Code of Federal Regulations

CGA Cylinder Gas Audit

CH₄ Methane Cl₂ Chlorine

ClO₂ Chlorine Dioxide

CNCG Concentrated Non-Condensable Gas

CO Catalytic Oxidizer

CO₂ Carbon Dioxide

COC Chain of Custody

CTM Conditional Test Method

CTO Catalytic Thermal Oxidizer

DNCG Dilute Non-Condensable Gas

Dioxins Polychlorinated Dibenzo-p-dioxins (PCDD's)

DLL Detection Level Limited dscf Dry Standard Cubic Feet EIT Engineer in Training

EPA Environmental Protection Agency

ESP Electrostatic Precipitator

EU Emission Unit

FID Flame Ionization Detector

Furans Polychlorinated Dibenzofurans (PCDF's)

GC Gas Chromatography

gr/dscf Grains Per Dry Standard Cubic Feet

H2SHydrogen SulfideHAPHazardous Air PollutantHCIHydrogen Chloride

HRSG Heat Recovery Steam Generator

IDEQ Idaho Department of Environmental Quality

lb/hr Pounds Per Hour

LRAPA Lane Regional Air Protection Agency
MACT Maximum Achievable Control Technology
MDI Methylene Diphyenyl Dilsocyanate

MDL Method Detection Limit

MEK Methyl Ethyl Ketone

MeOH Methanol

MMBtu Million British Thermal Units
MRL Method Reporting Limit
MS Mass Spectrometry
MSF Thousand Square Feet

NCASI National Council for Air and Steam Improvement

Abbreviations and Acronyms Used in the Report

NCG Non-condensable Gases

NCUAQMD North Coast Unified Air Quality Management District

NDIR Non-dispersive Infrared

NESHAP National Emissions Standards for Hazardous Air Pollutar
NIOSH National Institute for Occupational Safety and Health
NIST National Institute of Standards and Technology
NMVOC Non-Methane Volatile Organic Compounds

NO_x Nitrogen Oxides

NPD Nitrogen Phosphorus Detector

O₂ Oxygen

ODEQ Oregon Department of Environmental Quality

ORCAA Olympic Region Clean Air Agency
PAHs Polycyclic Aromatic Hydrocarbons
PCWP Plywood and Composite Wood Products

PE Professional Engineer
PM Particulate Matter

Parts Per Billion by Volume vdqq Parts Per Million by Volume ppmv Performance Specification PS **PSCAA** Puget Sound Clean Air Agency **PSEL** Plant Site Emission Limits pounds per square inch psi PTE Permanent Total Enclosure PTM Performance Test Method

QA/QC Quality Assurance and Quality Control
QSTI Qualified Source Testing Individual

RA Relative Accuracy
RAA Relative Accuracy Audit

RACT Reasonably Available Control Technology

RATA Relative Accuracy Test Audit

RM Reference Method

RTO Regenerative Thermal Oxidizer
SCD Sulfur Chemiluminescent Detector
SCR Selective Catalytic Reduction System

SO₂ Sulfur Dioxide SOG Stripper Off-Gas

SWCAA Southwest Clean Air Agency

TAP Toxic Air Pollutant

TCA Thermal Conductivity Analyzer TCD Thermal Conductivity Detector

TGNMOC Total Gaseous Non-Methane Organic Compounds

TGOC Total Gaseous Organic Compounds

THC Total Hydrocarbon

TIC Tentatively Identified Compound

TO Thermal Oxidizer


TO Toxic Organic (as in EPA Method TO-15)

TPH Tons Per Hour
TRS Total Reduced Sulfur
TTE Temporary Total Enclosure

VE Visible Emissions

VOC Volatile Organic Compounds WC Inches Water Column

WDOE Washington Department of Ecology
WWTP Waste Water Treatment Plant



Nomenclature

Constants	Value	Units	Definition	Ref
Pstd(1)	29.92126	hHg	Standard Pressure	CRC
Pstd(2)	2116.22	ibf/ft²		CRC
Tstd	527.67	#R	Standard Temperature	CRC
R	1545.33	ft lbf/lbmol °R	Ideal Gas Constant	CRC
MWatm	28.965	lbm / lbmolc	Atmospheric (20.946 %OZ, 0.033% CO2, Balance N2+Ar)	
MWc	12.011	lbm / lbmole	Carbon	CRC
MWco	28.010	Ibm / Ibmole	Carbon Monoxide	CRC
MWco2	44.010	lbm / lbmole	Carbon Dioxide	CRC
			Water	CRC
MWh2o	18.015	Ibm / Ibmole		CRC
MWno2	46.006	Ibm / Ibmole	Nitrogen Dioxide	CRC
MWo2	31.999	Ibm / Ibmole	Oxygen	CRC
MWso2	64.063	Ibm / ibmole	Sulfur Dioxide	CKC
MWn2+ar	28.154	Ibm / Ibmole (Balance with 98.82% N2 & 1,18% Ar)	Emission balance	
C1	385.3211	ft³ / fbmol	Ideal Gas Constant @ Standard Conditions	
C2 ·	816.5455	inHg in ² / °R fl ²	Isokentics units correction constant	D-62.61
Kp	5129.4	ff / min [(inHg lbm/mole) / (*R inH2O)] ^1/4	Pitot tube constant Calculating Equation or Source of Data	Ref 2.5.1 EPA
Symbol	Units	Definition	Calculating Equation of Source of Data	EFA
As	in ^z	Area, Stack		
An	in²	Area, Nozzle	(100 N (- 10 (1 N(1 N(1)(N(1)(E . 5 1
Bws	%	Moisture, % Stack gas	[100 Vw(std) / [Vw(std)+Vm(std)]]	Eq. 5-3
C	ppmv-C	Carbon (General Reporting Basis for Organics)		
C1	ft3/lbmol	Gas Constant @ Standard Conditions	[R Tstd / Pstd(2)]	l
C2	inHg in²/°R ft²		[14,400 Pstd / Tstd]	l
Cd		Mass of gas per unit volume	[Cgas MWgas / Cl]	Ea S S
cg	gr/dscf	Grain Londing, Actual	[15.432 mm / Vm(std) 1,000]	Eq. 5-6
cg @ X%CO2	gr/dscf	Grain Loading Corrected to X% Carbon Dioxide	[X%/C02%]	l
cg @ X%O2	gr/dscf	Grain Loading Corrected to X% Oxygen	[(20.946-X) / (20.946-O2)]	
Cgas	ppmv, %	Gas Concentration, (Corrected)		
Cgas @ X%CO2	ppmv	Gas Concentration Correction to X% Carbon Dioxide		
Cgas @ X%O2	ppmv	Gas Concentration Correction to X% Oxygen	[(20,946-X%) / (20.946-O2%)]	
Cgas	ppmv		Mgas (Ibm/hr) * 1,000,000*385.3211/60*Qsd*mw	
co	ppinv	Carbon Monoxide		
Co	ft	Outer Circumference of Circular Stack		
Ci	ft	Inner Circumference of Circular Stack		
CO2	%	Carbon Dioxide		
Cp		Pitot tube coefficient		
Ct	lb/hr	Particulate Mass Emissions	[60 cg Qsd/ 7,000]	
đН	in H2O	Pressure differential across orifice		
Dn	in	Diameter, Nozzle		
dp^1/2		Average square root of velocity pressure		i
Ds	in	Diameter, Stack		l
E	lb / MMBtu	Pollutant Emission Rate	Cgas Fd MWgas (20.946 / (20.946-O2)) / (1,000,000 C1)	
Fd	dscf / MMBtu	F Factor for Various Fuels		Table 19-1
1	%	Percent isokinetic	[C2 Ts(abs) Vm(std) / (vs Ps mfg An Ø)]	Eq. 5-8*
Md	lbm / lbmole	Molecular weight, Dry Stack Gas	[(1-%O2-%CO2)(MWn2+ar)+(%O2 MWo2)+(%CO2 MWco2)]Eq. 3-1*
mfg		Mole fraction of dry stack gas	[1-Bws/100]	
Mgas	lbm/hr	Gascous Mass Emisisons	[60 Cgas(ppmv) MW Pstd(2) Qsd / 1,000,000 R Tstd]	
mn	mg	Particulate lab sample weight		
Ms	lbm / lbmole	Molecular weight, Wet Stack	[Md mfg +MWh2o (1-mfg)]	Eq. 2-5
MW	Ibm / Ibmole	Molecular Weight		
NO2	ppmv-NO2	Nitrogen Dioxide (General Reporting Basis for NOx)		
NOx	ppmv-NO2	Nitrogen Oxides (Reported as NO2)		
O2	%	Oxygen		
OPC	%	Opacity		
Pbar	in Hg	Pressure, Barometric		
Pg	in H2O	Pressure, Static Stack		
Po	in Hg	Pressure, Absolute across Orifice	[Pbar + dH / 13.5951]	
Ps	in Hg	Pressure, Absolute Stack	[Pbar + Pg / 13.5951]	Eq. 2-6*
Qa	acf/min	Volumetric Flowrate, Actual	[As vs / 144]	´
Qsd	dscf/min	Volumetric Flowrate, Dry Standard	[Qa Tstd mfg Ps] / [Pstd(1) Ts(abs)]	Eq 2-10*
Rf	MMBtu/hr	-	1,000,000 Mgas (20.946-O2)]/[Cd Fd 20.946]	-
SO2	ppmv-SO2	Sulfur Dioxide		1
t	in	Wall thickness of a stack or duct		
TGOC	ppmv-C	Total Gaseous Organic Concentration (Reported as C)		
Tm	°F	Temperature, Dry gas meter		
Tm(abs)	R	Temperature, Absolute Dry Meter	[Tm+459.67]	
Ts	°F	Temperature, Austria Bry Meter	,	
Ts(abs)	°R	Temperature, Absolute Stack gas	[Ts + 459.67]	
Vic	ml	Volume of condensed water	1	
Vm	dcf	Volume, Gas sample		
Vm(std)	dscf	Volume, Ory standard gas sample	[Y Vm Tstd Po]/[Pstd(I) Tm(abs)]	Eq. 5-1
1 ' '	_		Kp Cp dp^½ [Ts(abs) / (Ps Ms)]^ ½	Eq. 2-9*
Vw(std)	fpm scf	Velocity, Stack gas	0.04707 VIc	Eq. 5-2
Y (Sta)	501	Volume, Water Vapor	Wester TIE	Fig. 5.6
1	min	Dry gas meter calibration factor		11g. J.U
* Resed on equation	min	Time, Total sample		

* Based on equation.

Total Chrome

Total Chrome and Flow Rate Results
Example Calculations
Field Data
Sample Recovery Field Data and Worksheets
Laboratory Results and COC
Traverse Point Locations
Tedlar Bag Field Data and Analyzer Calibration Data

EPA Method 29 Chromium Results

Saint Gob	pain Containers				11	-Mar-10									
Furnace #	5, CC Inlet					PS									
Seattle, W	/A					MEW									
Vm(std)	dscf	55.18	82.38	86.80	74.79										
	dscm	1.563	2.333	2,458	2,12										
Q(std)	dscf/min	9,326	9,147	8,853	9,109										
Time	min	120	180	180											
Oxygen	%	19.00	19.20	19.00	19.07										
Glass Produ	uction (ton/hr)	3.13	3.13	3.13	3.13										
TOTAL					BACK H	AIE			FRONT F	IAIE					
			IOIA	بالا				DACK	ALA			PRONT	IML		
RESULTS	_	Run 1	Run 2	Run 3	Avg		Run 1	Run 2	Run 3	Avg	Run I	Run 2	Run 3	Avg	
RESULTS Chromium		Run 1 985.80			Avg 1365.00		Run 1 13.80			Avg 7.67	Run 1 972.00			Avg 1357.33	
	ug		Run 2	Run 3				Run 2	Run 3			Run 2	Run 3		
Chromium	ug RATIONS	985.80	Run 2 1523.50	Run 3 1585.70			13.80	Run 2 3.50	Run 3 5.70		972.00	Run 2 1520.00	Run 3 1580.00		
Chromium CONCENT	ug RATIONS ug/m3	985.80 Run 1	Run 2 1523.50 Run 2	Run 3 1585.70 Run 3	1365.00		13.80 Run 1	Run 2 3.50 Run 2	Run 3 5.70 Run 3	7.67	97 2.00 Run 1	Run 2 1520.00 Run 2	Run 3 1580.00 Run 3	1357.33	

Run 2

1.64E-05

Run 3

4.65E-05

2.45E-05

Run I

6.93E-03

Run 2

7.13E-03

Run 3

6.95E-03

6.80E-03

Run 1

9.85E-05

PRODUCTION BASED

Chromium lbm/ton

Run 1

7.03E-03

Run 2

7.14E-03

Run 3

7.00E-03

6.83E-03

Flow Rate and Moisture

Client Saint Gobain Containers 3/11/10 Date
Source Furnace #5, CC Inlet PS Operator
Location Seattle, WA 3472
1,2,3,4,29 mew Analysist/OA

	1,2,3,4,29				10011 12	nalysist/QA
Definitions	Symbol	Units	Run I	Run 2	Run 3 A	rerage
Time, Starting			8:25	10:50	14:10	
Time, Ending			10:28	13:57	17:16	
Volume, Gas sample	Vm	dcf	57.601	85.475	90.798	77.96
Temperature, Dry gas meter	Tm	°F	79.17	75.92	80.44	78.51
Temperature, Stack gas	Ts	°F	408.42	378.81	398.64	395.29
Pressure differential across orifice	dH	in H2O	0.693	0.668	0.763	0.71
Average square root velocity pressure	dp^1/2	in H2O^1/2	0.548	0.562	0.519	
Diameter, Nozzle	Dn	in	0.2648	0.2643	0.2648	
Pitot tube coefficient	Сp		0.8392	0.7871	0.8392	
Dry gas meter calibration factor	Y		0.98392	0.98392	0.98392	
Pressure, Barometric	Pbar	in Hg	29.70	29.70	29.70	
Pressure, Static Stack	Pg	in H2O	-2.2	-2.2	-2.2	
Time, Total sample	Ø	min	120	180	180	160
Stack Area	As	in²	1017.9	1017.9	1017.9	
Nozzle Area	An	in²	0.0551	0.0549	0.0551	
Volume of condensed water	Vlc	ml	104.4	154.5	173.5	144.12
Oxygen		% O2	19.00	19.20	19.00	19.07
Carbon Dioxide		% CO2	3.60	3.00	3.80	3.47
Molecular weight, Dry Stack	Md	Ibm / Ibmole	29.46	29.37	29.49	29.44
Pressure, Absolute Stack	Ps	in Hg	29.54	29.54	29.54	29.54
Pressure, avg arcoss orifice	Po	in Hg	29.75	29.75	29.76	29.75
Volume, Dry standard gas sample	Vm(std)	dscf	55.18	82.38	86.80	74.79
Volume, Water Vapor	Vw(std)	scf	4.91	7.27	8.17	6.78
Moisture, % Stack (EPA 4)	Bws(1)	%	8.18	8.11	8.60	8.30
Moisture, % Stack (Psychrometry-Sat)	Bws(2)	%	na	na	na	
Moisture, % Stack (Theoretical)	Bws(3)	%	na	na	na	
Moisture, % Stack (Psychrometry)	Bws(4)	%	na	na	na	
Moisture, % Stack (Predicted)	Bws(5)	%	na	na	na	
Mole Fraction dry Gas	mfg		91.8%	91.9%	91.4%	91.7%
Molecular weight, Wet Stack	Ms	lbm / lbmole	28.52	28.45	28.50	28.49
Velocity, Stack gas	vs	fpm	2,394	2,267	2,258	2,306
Volumetric Flowrate, Actual	Qa	acf/min	16,924	16,023	15,960	16,303
Volumetric Flowrate, Dry Standard	Qsd	dscf/min	9,326	9,147	8,853	9,109
Percent Isokinetic	I	%	91.1	92.8	100.6	94.9



13585 NE Whitaker Way • Portland, OR 97230 Phone (503) 255-5050 • Fax (503) 255-0505 www.horizonengineering.com

	Example	e Calculation	IS		
0.1	Metals	Emissions	_	No.5 - Clard Chamber Inle	_
Client:	Gobain	Source	turnace	No.5 - Cloud Chamber Inle	1
Date 03/11/2010	_ Project # <u>3472</u>	Run # 2	_		

Metals Emissions - Mass Rate

Metal <u>Cr</u> measured <u>1523.5µg</u>

Sample Volume 82.38 dscf Flow Rate 9,147 dscf/min

Equation:

$$lb - \underline{C\tau}/hr = \frac{measured\mu g * mg/1000\mu g}{SampleVolume} * FlowRate * \frac{60 \min}{hr} * \frac{lb}{453592.37mg}$$

Calculation:

$$\frac{1523.5 \mu g * mg/1000 \mu g}{82.38 dscf} * \frac{9.147 dscf}{min} * \frac{60 min}{hr} * \frac{1b}{453592.37 mg} = 0.0224 lb-Cr/hr$$

Sample Calculations, Chromium Concentration

Client: Saint Gobain Source Fornace No. 5- Good Chamber Inte Date 3/11/2010 Project # 3472 Run # 2 Page 2

CHROMIUM CONCENTRATION. mg/dscm

Measured Results, gr/dscf 0.000 2854

Equation:
$$CR, mg/dscm = Cr, gr/dscf \times \frac{lb}{7000gr} \times \frac{453,592mg}{lb} \times \frac{35.315cubicft}{cubicMeter}$$

Calculation:
$$\frac{0.002854}{0.653} \frac{Cr, gr/dscf}{dscm} \times \frac{lb}{7000gr} \times \frac{453,592mg}{lb} \times \frac{35.315cubicft}{cubicMeter}$$

$$= \frac{0.653}{653.1} \frac{Cr, mg/dscm}{dscm}$$

Sample Calculations, Additional Concentrations & Rates

Client: Saint Gobain Source Frace No. 5- Good Charber Inle Date 3/1/2010 Project # 3472 Run # 2

Chromium Emissions Production Based: lb/ton glass production:

Measured Cr Results, lb/hr 0.0224

Glass Production (Pull Rate), tons/day 75, 2

Equation: $\frac{lbCr}{tonGlass} = \left(\frac{lbCr}{hr}\right) \times \left(\frac{day}{tonsGlass}\right) \times \left(\frac{24hr}{day}\right)$

Calculation: $\left(\frac{0.0224}{hr}lbCr\right) \times \left(\frac{day}{75.2 tonsGlass}\right) \times \left(\frac{24hr}{day}\right) = \frac{0.00715}{tonGlass}lbCr$

Client: Saint Gobaln Date 3/11/2010
Source Funace 5-Clad Chamber Inlet Project # 3472

Whate S Close Charges 4 Alet Floject # 51/2 Kull # 2

Molecular Weights (lb/lbmol):

CO ₂ =44.01	O ₂ =31.999	N ₂ +Ar=28.154	H ₂ O=18.01	5 atm=28.965
Constants:				·
Pstd(1)=29.92129	in Hg Tstd=527.6	67 °R Kp=512	29.4 C2=8°	6.5455inHq in²/°R ft²

Pressure, Absolute Stack (Ps): Ps, inHg = $P_{\text{Barometric}} + \frac{P_{\text{static}}}{13.6} = \frac{29.70}{13.6} \text{ inHg} + \frac{2.2}{13.6} \text{ in H2O} = \frac{29.54}{13.6} \text{ in Hg}$

Volume, Dry Standard Gas Sample (Vm[std]): $Tm = \frac{75.9}{0.668} \circ F + 459.7 = \frac{535.6}{0.668} \circ R$

Orifice Pr ess = Pb $\frac{29.70}{13.6}$ in Hg + $\frac{0.668}{13.6}\Delta H = \frac{29.75}{13.6}$ in Hg

 $Vm(std)ft^{3} = \frac{Y \times MeterVol \times Tstd \times Orifice \Pr{es(Po)}}{Pstd(1) \times Tm \circ R}$

 $= \frac{\sqrt{\frac{98392 \times 85,475}{5}} ft^3 \times 527.67 \circ R \times (Po 29.75 in Hg)}{29.9213 in Hg \times 535.6 \circ R} = \frac{8238}{4scf}$

Moisture, % Stack Gas (bws): $V_{wstd} = 0.04707 \times Cond.H2O, ml = 0.04707 \times \underline{154.5}ml = \underline{7.27}scf$ $bws = 100 \times \frac{V_{wstd}}{V_{wstd} + V_{mstd}} = \frac{\underline{7.27}scf}{\underline{7.27}scf + \underline{82.38}dscf} = \underline{\underline{8.11}}\%$

Mole Fraction Gas (mfg): $1 - \frac{bws}{100} = 1 - \frac{8.11 \%}{100} = 0.9189$

Molecular Weight, Dry, Stack (Md):

 $Md\frac{lb}{lbmol} = \left[(1 - \frac{O_2}{100} - \frac{CO_2}{100}) \times MolWtN2Ar \right] + \left[\frac{O_2}{100} \times MolWtO2 \right] + \left[\frac{CO_2}{100} \times MolWtCO2 \right]$

 $= \left[(1 - \frac{19.2 \% O_2}{100} - \frac{3.0 \% CO_2}{100}) \times 28.154 \frac{lb}{lbmol} \right] + \left[\frac{19.2 \% O_2}{100} \times 31.999 \frac{lb}{lbmol} \right] + \left[\frac{3.0 \% CO_2}{100} \times 44.010 \frac{lb}{lbmol} \right] = \frac{29.37}{lbmol} \frac{lb}{lbmol}$

Client: St. Gobam

Date 3/1/2016

Molecular Weight, Wet, Stack (Ms):

$$Ms \frac{lb}{lbmol} = (Md \times mfg) + (MolWtH_2O \times (1 - mfg)) = \left(\frac{2937}{lbmol} \times \frac{9189}{lbmol}\right) + (18.015 \times (1 - \frac{9189}{lbmol}))$$

$$= \frac{28 \times 45}{lbmol} \frac{lb}{lbmol}$$

Stack gas (vs):
$$Ts = 278.8 \circ F + 459.7 = 938.5 \circ R$$

$$= vs \frac{feet}{\min} = Kp \times Cp \times dp \sqrt{inH_2O} \times \sqrt{\frac{Ts \circ R}{Ps \times Ms}}$$

= 5129.4 ft/min... ×
$$\frac{7671}{\times}$$
 × $\frac{.562}{dp\sqrt{inH_2O}}$ × $\sqrt{\frac{.838.5}{29.54}} = \frac{.8}{lbmol}$ = $\frac{.2266.4}{min}$ min

Flow Rate, Actual (Qa):

$$Qa \frac{actualCubicFeet}{\min} = \frac{AreaStack \times vs}{144} = \frac{\boxed{117.9}_{in^2} \times 2266.9 \frac{ft}{\min}}{144} = \frac{\boxed{6021}_{acfm}}{144}$$

Flow Rate, Dry Standard (Qsd):

$$Qsd \frac{dryStdFt^{3}}{\min} = \frac{Qa \times Tstd \times mfg \times Ps}{Pstd(1) \times Ts \circ R} = \frac{\left(6,02\right) \cdot acfm \times 527.67 \circ R \times \frac{0.909}{0.9213inHg} \times \frac{29.54}{0.9213inHg} \times \frac{29.54}{0$$

			- 1		riciu Dat								
		13585 NE	Whitaker Way				Client:	4RTH	+ Cook	2ain			
		Portland,	OR 97230		Client: Sertle, WA Location: F5								
HORIZ ENGINEE		•	3) 255-5050				Locatio	n: F5	- '	1.			
	, / . / .	Fax (503)	255-0505	{	Probe 1-3 (g/s) Cp , 839 2 Heat Set Z 50							2 6 9 8	
Date 3				-					nspection				2 5 0 F D=damaged)
	ent Testing		· .	-			Pitot Ll		шресио	Pre: Hi	<i>∂</i> @4		@
Run#			80 (= 1525 - 80		Stack Diagram	13	in H2O	@in H2 (Lo	O@L	1	@
Operator		Support		<u>.</u>	ALT-011		Nozzle	.264	8 Q4	Oven /			
	ture, Ambi		(Ta) 45	Std TC	(ID/°F)	3.	Filter	·- 1T	-1110	1 /		at Set 2	
Moisture Press St	1, 10	Tdb	- Twb - ress., Bar (Pb) 29.7	_	inuity Check (Meter I		dH@ /	Pretest:			839-2 3 inHg
			If yes, avg. null angle_		minit cheer () · ·	Leak Cl			Post: 0			
Traverse Point	Sampling Tizne	Clock Time	Dry Gas Meter Reading	Velocity Head in H2)	Orifice Pressure in H2O	Orifice Pressure H2O	STACK	PROBE	OVEN Filter	IMPINGER Outlet	METER Iniet/Avg.	METER Outlet	Pomp Vacuum
Number	##in (dt)	(24 hr)	cuft (Vm)	(dPs)	DESIRED	ACTUAL (dH)	°F (aT)	'F (Tp)	*F	"F	Tan-in)	*F (Tm-out)	inHg (Pv)
	(4.)	8:25	747.415	1		(42)	Amb:	Amb:	Amb;	Amb:	Amb:	Amb:	
1	5	000	750.30	,45	,969	,97	417	241	240	47	69	66	3
2	10		753.14	,45	1969	.97	417	243	240	49	69	67	3
3	15		756-	,43	,933	,93	4/6	242	24/	48	72	67	3
4	20		758.54	137	,807	181	412	243	241	49	74	68	3
5	25		760.98	,32	1703	.70	410	243	241	51	76	69	3
6	30		763.32	,28	1019	.62	410	ユムユ	240	52	78	70	3
7	35		765.42	,22	,48 Cc	,49	410	249	245	52	80	71	3
8	40		767.46	122	,486e	,49	408	247	7.45	54	82	73	3
9	45		769.94	132	.707	.71	412	246	244	55	83	74	3
10	50		772.36e	,30	,687	-69	386	249	245	52	85	75	3
11	55		7/4.79	130	1669	,67	408	244	244	52	85	75	3
12	100	925/28		130	,669	,67	408	-			85	75	3
13	65		780.19	,51	1.12).1	1.	245		54	83	77	3
14	70		783	,48	1.06	1.)	423			54	86	78	3
15	75		786.19	,46	1.02	[.0	_	248	-	55	88	78	4
16	80		789.07	,43	.957	.96			245	60	89	79	4
17	85		79[.87	,40	,890	.29			244	52	90	<i>79</i>	4
18	98		794.35	131	1698	.70			245	51	90	80	4
19	95		796.28	,18	,405	,41	406			48		<i>30</i>	3
20	100		797.94	,14	,320	,37	396		240	49		80 80	3
21	105		799.76	,10	,366	.37	394	_	244	50		81	3
22	110		801.54	,16	,366		393		244	50		81	3
23	115		803.27	. 15	,343	, 34	390	_	244	50		タ/	3
24	190	16:28	805.016	, 5	, -, (, 2	, 3닉	392	144	244	51	87	8/	3
Notes:			<u> </u>										22

Notes: Nozzle

2650 , 2648

					Field Dat	a Sheet								
		13585 NE	Whitaker Way	<u> </u>			Client	6-11	+ (20	100-10		-		
			OR 97230				Client: Sasut Coloain Plant: Scattle, W.A.							
HORIZ	ZON!	•	03) 255-5050				Locatio	n: F-5		,				
ENGINE	331112	•	255-0505		Sample Location: lulet									
Date 3/16/10				7	1002	_				Cp. 78	7/ н	cat Set	250 °F	
Test Method				7	100			_	inspectio			no change,	D=damaged)	
Concurr	ent Testing	; <u>-</u>					Pitot L	k Rate	•		O@4		@	
Run#				1	Stack Diagram	<u> </u>		@in H20			0 @L	<i>f</i> '	@	
Operato		Support			<u>ALT-011</u>			1264	13 05	Oven J		ip. Outle		
	ature, Amb		(Ta) 45 - Twb -		(ID/°F)		Filter		1110	1.650	H.	eat Set		
			- Twb - ress., Bar (Pb) 29,7		C (ID/°F)			Box 4/	dH@				8392	
			Zif yes, avg. null angle_	degrees	inuity Check	1 or 1	Mete Leak C			Pretest:	0.004	cfm (inHg inHg	
Traverse	Sompling	Clock	Dry Gas Meter	Velocity Head	Orifice Pressure	Orifice Pressure	STACK		OVEN	IMPINGE		METER		
Point Number	Time min	Time (24 hr)	. Reading	in H2) (dPs)	in H2O DESIRED	H2O ACTUAL	*F	*F	Filter *F	Outlet *F	inict/Avg	Outlet F	Vacuum inHg	
	(dt)		(Vm)	4		(dH)	(Ts) Amb;	(Tp)	(To)	(Ti) Amb;	(Tm+in) Amb:	(Tm-out) Amb:	(Pv)	
		10:50	805.410	1.1							 			
1	5		808.15	,44	,869	87	396	244	245	49	81	78	3	
2	10		810.81	,42	,829	.83	395	24Le	244	48	78	77	3	
3	15		813.45	,42	,829	.83	393	242	246	45	79	78	3	
4	20		8:5.80	,33	,652	,65	391	242	245	46	79	76	3	
5	25		818	,33	,652	. 65	390	242	246	46	79	75	3	
6	30	·	820.31	,24	.476	, 48	391	242	246	46	3	75	3	
7	35		82227	,22	,439	44	<i>J8</i> 6	241	246	46	80	75	3	
8	40		824.34	,25	,499	.50	386	241	247	47	So	74	3	
9	H5_		826	132	638	, Lot	381	ZUR	246	44	80	74	3	
10	50		829.10	134	,678	.68	378	249	245	45	80	74	4	
11	55		831.44	, 31	, CeHLo	.65	350	248	247	45	20	73	4	
12	60	1150	833.809	, 3[1646	,65	357	248	746e		80	74	4	
13	65		836.77	,51	1.00	1.0	395	250	246	45		72	5	
14	70.		839.68	,51	,999	1.0	399	250	246	46	79	74	5	
15	75		842.55	, 49.	,957	.96	402		246	43	80	73	5	
16	80		845.36	.47	.97	.92	401	• 0	246	42	80	73	5	
17 -	85		848.00	,41	.805	.81	396			42	80	72	5	
18	90		850	131	ile12	. [e]		243		41	₹	72	5	
19	95		852.12	.18	,350	·36	386			И	\$3	72	3	
20	100		853.83	118	,358	. 36			246	42	80	72	3	
21	105		855.56	,18	.358	,36e			145	42	79	72	3	
22	110	'	857.37	,18	,383	.38		- ``	246	42	78	72	3	
23	115		859.16	115	,320				245	42		72	3	
24	12-0	1253	860.807	, 5	.320	, 32	326	192	245	42	78	72	3	
Notor:			<u> </u>				<u> </u>						23	

Notes: 2645 \ 2645 \ 2645

	-	13585 NE	Whitaker Way				Client:	Script	(50)	क्र-वर्श ने				
37/10		Portland,	OR 97230				Plant: Seattle, We							
	HORIZON ENGINEERING Phone (503) 255-5050			,			Location:							
	110	Fax (503)	255-0505			7	Sample Location: inlet							
Date 3/11/10							Probe 4-7 (g/s) Cp , 787/ Heat Set 256°F							
Test Method							Post-Tes	t Pitot I	nspection)=damaged)	
	ent Testing	-	·				Pitot Lk			Pre: Hi) @ 4	
Run# 2					Stack Diagran	1	in H2O				O@ 4		ラ@4 <u></u>	
Operator		Support	P9		ALT-011			264	<u> 3 (25</u>	Oven /				
	ture, Ambie		(Ta) 45		ID/°F)		Filter			1.00		at Set		
Moisture		Tdb	Twb -		C (ID/°F)		Meter B		dH@ /	,650			8512	
Cyclonic	atic (Pstat)	rted 2 N/2	ess., Bar (Pb) 29.7 If yes, avg. null angle_		nuity Check	or t	Meter Lenk Ch			Pretest: O				
Traverse	Sampling	Clock	Dry Gas Meter	Velocity Head	Orifice Pressure	Orifice Pressure	STACK	PROBE	OVEN	IMPINGER	METER	METER	Pump	
Point	Time	Time	Reading cuft	in H2) (dPs)	in H2O DESTRED	H2O ACTUAL	*F	*F	Filter *F	Outlet *F	Inlet/Avg. *F	Outlet *F	Vacuum inHg	
Number	min (dt)	(24 hr)	(Vm)	(ars)	DESIRED	(dH)	(Is)	(Tp)	(To)	(Ti)	(Tm-in)	(Tm-out)	(Pv)	
		12:51	860.807				Альь:	Amb:	Amb;	Amb:	Amb:	Amb:		
1	125	1 17 10 _ 1	863.56	.47	.914	.91	400	248	245	45	74	71	6	
2	130		866.33	47	.9(4	.91	397	240	245	46	フフ	7/	6	
3	135		869.05	,44	,855	,86	396	246	246	47	787	7[6	
4	140		871.54	,37	,725	.73	393	248	246	45	79	72	6	
5	145		873.78	130	,572	.59	387	247	246	45	79	71	5	
6	150		875.84	,26e	,513	.51	384	247	245	76	78	71	5	
1	195		878.05	.23	,546	,55	384	245	255	46	78	フ/	5	
2	160		380.25	, 23	.546	,55	384	245	246	47	78	7/	5	
3	165		882.86	132	,768	.77	382	241	245	48	79	72	5	
4	170		885.52	132	768	,77	374	245	240	47	79	7/	<u>(a</u>	
5	135		888.20	132	1819	.82	330	243	245	47	19	71	6	
6	180	13:57	890.885	.32	,819	.82	SHE	240	245	47	19	7/	6	
							\vdash							
\vdash			•					,						
			4.5											
			•						\vdash					
\vdash						s·	$\vdash\vdash\vdash$				\vdash			
			·	,					$\vdash \vdash \vdash$					
									$\vdash \vdash \vdash$					
\vdash							$\vdash \vdash \vdash$		$\vdash \vdash \vdash$, , ,	
							$\vdash\vdash\vdash$		\vdash		$\vdash \vdash \vdash$			
							\vdash		$\vdash \vdash \vdash$					
			,				$\vdash \vdash$						24	
			· · ·			· n ·		12					24	
Notes:	را	hang!	ed mo:sture	- to 9%	o at 15	0 mino	۶.							

					ricid Dai	AL DILUUT										
- Set			E Whitaker Way	1					+ Gol	lain.	· .	\(\frac{1}{2}\)	S 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			
HODI	Portland, OR 97230								Plant: Seattle, WA Location: F5							
	VI-1/1/2017/1-1 X HOLE (505) 255-5050						Sample Location: /ule+									
Date 2	Date 3/1/10						Pucho Me 3 (Maga C 297) Was a C 257									
Test Me	1			1 '			Probe 4-3 (g/s) Cp. 8392 Heat Set 25 Post-Test Pitot Inspection (NC=no change, D=da									
Concur	rent Testin	g —					Pitot L				000		@			
Run#					Stack Diagra		in H2O	@in H2			Lo 6@3 @					
Operato		Suppor			ALT-011			126	18 17	Oven /						
Moistur	e 900	Tdb	(Ta) 45		(ID/°F) C (ID/°F)		Filter Meter l	Box W	dH@	1.650		eat Set 2	2 <i>50</i> °F 3392			
			ress., Bar (Pb) 79,		inuity Check		Met		une		0.000					
Cyclonic	c Flow Exp	ected ?///	If yes, avg. null angle	degrees			Leak C	heck		Post:		cfm	inHg			
Traverse Point	Sampling Time	Clock Time	Dry Gas Meter Reading	Velocity Head in H2)	Orifice Pressure in H2O	Orifice Pressure H2O	STACK	PROBE	ÖVEN Filer	IMPINGEI Outlet	R: METER Inict/Avg		Pump Vacuum			
Number	(qt)	(24 hr)	cust (Vm)	(dPs)	DESTRED	ACTUAL (dH)	*F (Ts)	*F (Tp)	*F (To)	*F	*F (Tm-in)	*F	inHg			
		14:14	891.137	<u></u>		(==,	Amb:	Amb:	Amb	Amb:	Amb;	Amb:				
1	5		894.17	,40	1.07	10	402	25-	7241	49	73	70	3			
2	10		897.19	140	1.07	1.	402	258	241	48	75	71	3			
3	15		900.08	137	,994	.99	397	257	243	47	77	72	3			
4	70		90292	,34	,913.	,91	395	257	244	47	78	7/	3			
5	25		905.42	.28	,752	.75	392	258	245	47	79	71	3			
6	30	Ĺ	907.600	,21	.572	.57	390	258	2.44	48	80	72	3			
7	35		909.71	18	,490	.49	388	257	245	46	80	72	3			
8	40		911.93	121	,572	,57	390	258	745	46	80	72	3			
9	45		914.45	128	,758	.76	395	328	245	47	81	72	3			
10	50		917.	18	1758	-76	394	357	245	45	20	73	3			
11	55	12:10	919.59	178	,758	.76	399	256		46	82	14	3			
12	60	15:10		1 2 8	,758	176			745		87	74				
13	65		925.30	1410	1.23	1.2	410				82	75	4			
14	70.	1	931 59	.1/0	1,23	1,2		_	246	48	84	76 71	4			
15	75		101.01	,43	1,15	1.7	410	257	244	47	85	16	4			
16	85		934.67	13Ce	1.01	1.1	406		246 246	47	85 86	76 77	4			
17	90		940.14	177	.735	74		258	245	48	577	77	4			
18	95		941 89	1/2	1330	,33	393	257	245	_	88	79	3			
20	100		943.60	, 2	1330	.33	399	258	245	49	86	78	3			
21	105		945.49	, 4	387	,39	 	256	244	49	85	79	3			
22	110		947.40	,14	,391	.39		255	215		86	79	3			
23	115		949	12	,335	,34	380	25Te	245	50	87	80	3			
24	120	16:13	950.831	,12	,335	.34	335	156	145	50	86	79	3			
25			·	,									25			
Notes:																

		13585 NE	Whitaker Way				Client:	Sam	+ Goi	bein			,	可
	Portland, OR 97230						Client: bant Gobein Plant: beatte, wh							
HORIZ	(ON)	-	03) 255-5050	ŀ			Location: 45							
ENGINE	RING	Fax (503)					Sample Location: In Let							
Dote 7	liller	(555)									92 0	ot Set	7.6-7.0	ٳؙۣۜڐۣ۪
Date 3/11/(O Test Method			-			Probe 1/3 (g/s) Cp .8392 Heat Set 250 °F Post-Test Pitot Inspection (NC=no change, D=damaged)								
				-i					переспо					7
	ent Testing	,		4	a		Pitot L						<u>0@4</u>	_
Run # 2			. 04	<u> </u>	Stack Diagram	<u> </u>		@in H2C			<i>D</i> @ 7		<u> </u>	┙
Operator		Support		-	ALT-011		Nozzle , 2648 Q40ven /8 Co Imp. Outlet /-10							
	ture, Ambi		(Ta) 45		(ID/°F)		Filter			7.2-0			250°	
Moisture		Tdb	Twb -	-	C (ID/°F)		Meter I		dH@ /	.656			8392	_
Press., S	tatic (Pstat)	P.	ress., Bar (Pb) 29.7	-	inuity Check	† or ↓	Met				,004		O inH	g
			If yes, avg. null angle	degrees			Leak C				003	cfm /	Ø inH	g
Traverse Point	Sampling Time	Clock Time	Dry Gas Meter Reading	Velocity Head in H2)	Orifice Pressure in H2O	Orifice Pressure £120	STACK	PROBE	OVEN Filter	IMPINGER Outlet	METER Inlet/Avg.	METER Outlet	Pump Vacuum	1
Number	min (dt)	(24 hr)	cufi CV->	(dPs)	DESIRED	ACTUAL	°F	*F	*F	*F	°F	*F	inHg	П
	(ai)	11.011	950.831	1		(dH)	(Ts) Amh:	(Tp) Amb:	(To) Amb;	Amb:	(Tm-in) Amb:	(Tm-out) Amb:	(Pv)	н
		1(oillo	0,00.001			1	ļ.,						<u> </u>	4
1	25		953.92	,43	1,16	1.2	405	257	244	50	83	79	5	1
2	130		957.08	14[]./	407	258	245	50	87	80	5	J
3	135		96011	139	1.06	1,1	408	258	745	51	88	80	5	
4	140		962	,31	,839	.84	410	758	145	52	90	25	5	1
5	145		965.30	,26e	1703	.70	408	260	246	54	90	80	4	1
6	150		967.46	,20	.54le	,55	402	258	245	52	91	81	4	1
7	155		969.47	ille	,437	.44	397	258	245	50	39	81	3	1
8	160		971.71	120	,546	,55	397	257	244	51	88	20	3	1
9	165		974. —	127	1737	.74	402	258	245	52	88	80	3	1
10	170		976.85	,27	.737	.74	395	155	243	51	\$	8/	4	1
11	175		979.41	127	,733	773	407	256	245	51	88	81.	4]
12	180	17:16	981.935	,27	,733	.73	406	756	244	51	29	81	4]
13							1]
14						_								
15]
16														
17 .			•											
18														
19														
20														
21														
12														
3								\neg				\neg		
4							$\overline{}$							1
5									\neg				26	
Votes:			·										لسستاك	E

Sample Recovery / Moisture Catch

Saint Gobain Containers Furnace #5, CC Inlet Seattle, WA 3/11/2010 PS 3472


,															n	new
Definitions	Symbol	Units		Run	1			1	Run	2			Run	. 3		
Impinger Contents																\neg
			3	4	5A	5B	5C	3	4	5A	5B 5	C 3	4	5A	5B	5C
	Rinse #2	g														
	Impinger, Contents, Condensate & Rinse#1	g	123.00						525.00				548.00			
spg	Impinger, Contents & Condensate	g		381.00				1	428.00			1	448.00			
g/ml	Impinger	g	25.00	74.00				26.00	75.00			20.00	75.00			ļ
1.0590) 10% H2O2 / 5% HNO3	ml		200.00					200.00				200.00			
1.1515	5 4% KMnO4 / 10% H2SO4	$\mathbf{m}\mathbf{l}$		0.00					0.00				0.00]
1.0010	5 0.1 N HNO3	ml		0,00					0.00				0.00			
0.9982	2 H2O	шI		0.00					0.00				0.00			
1.0878	8 8N HCL / H2O	ml		0.00					0.00				0.00			
	Condensate	g		95.20					141.20				161.20			
	Rinse	g	98.00	100.00				97.00	97.00			99.00	100.00			
			00.00	68.88				07.00	07.00				100.00			
	0.1 N HNO3	gm	98.00					97.00					100.00			ļ
		ml	97.84	98.84				96.84	96.84			98.84	99.84			- 1
Rinse + Initial	10% KMnO4	gm														- 1
		ml														- 1
	10% H2O2 / 5% HNO3	gm														- 1
		ml		200.00					200.00			1	200.00			- 1
	8N HCL / H2O	gm						1								- 1
		ml														
Silica Gel Impinger	Final weight	g		529.00					633.00				532.00			
<u>-</u>	Initial weight	g		520.00				1	620.00				520.00			1
	Gain	g		9.00					13.00				12.00			
												1				
Total Moisture Gain		g		104.20					154.20				173.20			
Vlc	Net Moisture Gain	ml		104.39	1				154.47				173.51			



13585 NE Whitaker Way • Portland, OR 97230 Phone (503) 255-5050 • Fax (503) 255-0505 www.horizonengineering.com

Sample I Client: St. Gasain S	Recovery W eather Wh	forksheet – Source:	Furnace #5	ulti-Metals C.C. Inlef
Run No.:	,		000311	
Container No.	Empty Container	Impinger Contents	grams Impinger Contents w/ Rinse	Additional Impinger Contents with Rinse
#1 Filter #3 Probe Rinse, HNO ₃ #4 HNO ₃ or HNO ₃ /H ₂ O ₂ #5A, 0.1 N HNO ₃ # 5B KMNO ₄ /H ₂ SO ₄ /H ₂ O #5C 8N HCI / H ₂ O #6 Silica Gel	25 74 520	<u>381</u> <u></u> <u>529</u>	123	
Run No.: 2	Test	Date:	010 031/ grams	
Container No.	Empty Container	Impinger Contents	Impinger Contents w/ Rinse	Additional Impinger Contents with Rinse
#1 Filter #3 Probe Rinse, HNO ₃ #4 HNO ₃ or HNO ₃ /H ₂ O ₂ #5A, 0.1 N HNO ₃ # 5B KMNO ₄ /H ₂ SO ₄ /H ₂ O #5C 8N HCI / H ₂ O #6 Silica Gel	26 75 ———————————————————————————————————	428	123 525	
Run No.:	Test	Date: 20	γ <i>D D</i> 3 <i>l /</i> grams	
Container No.	Empty . Container	Impinger Contents	Impinger Contents w/ Rinse	Additional Impinger Contents with Rinse
#1 Filter #3 Probe Rinse, HNO ₃ #4 HNO ₃ or HNO ₃ /H ₂ O ₂ #5A, 0.1 N HNO ₃ # 5B KMNO ₄ /H ₂ SO ₄ /H ₂ O	75	<u>448</u>	<u></u>	
#5C 8N HCl / H ₂ O #6 Silica Gel	520	532		

AL Dellistian Publication Testing

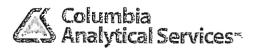

April 8, 2010

Analytical Report for Service Request No: K1002411

Margery Heffernan Horizon Engineering, LLC 13585 NE Whitaker Way Portland, OR 97230

RE: St. Gobain F5 Inlet/3472

Dear Margery:

Enclosed are the results of the samples submitted to our laboratory on March 15, 2010. For your reference, these analyses have been assigned our service request number K1002411.

Analyses were performed according to our laboratory's NELAP-approved quality assurance program. The test results meet requirements of the current NELAP standards, where applicable, and except as noted in the laboratory case narrative provided. For a specific list of NELAP-accredited analytes, refer to the certifications section at www.caslab.com. All results are intended to be considered in their entirety, and Columbia Analytical Services, Inc. (CAS) is not responsible for use of less than the complete report. Results apply only to the items submitted to the laboratory for analysis and individual items (samples) analyzed, as listed in the report.

Please call if you have any questions. My extension is 3316. You may also contact me via Email at JChristian@caslab.com.

Respectfully submitted,

Columbia Analytical Services, Inc.

Jeff Christian

Laboratory Director

JC/rlı

Page 1 of <u>15</u>

Acronyms

ASTM American Society for Testing and Materials

A2LA American Association for Laboratory Accreditation

CARB California Air Resources Board

CAS Number Chemical Abstract Service registry Number

CFC Chlorofluorocarbon
CFU Colony-Forming Unit

DEC Department of Environmental Conservation

DEQ Department of Environmental Quality

DHS Department of Health Services

DOE Department of Ecology
DOH Department of Health

EPA U. S. Environmental Protection Agency

ELAP Environmental Laboratory Accreditation Program

GC Gas Chromatography

GC/MS Gas Chromatography/Mass Spectrometry

LUFT Leaking Underground Fuel Tank

M Modified

MCL Maximum Contaminant Level is the highest permissible concentration of a

substance allowed in drinking water as established by the USEPA.

MDL Method Detection Limit
MPN Most Probable Number
MRL Method Reporting Limit

NA Not Applicable
NC Not Calculated

NCASI National Council of the Paper Industry for Air and Stream Improvement

ND Not Detected

NIOSH National Institute for Occupational Safety and Health

PQL Practical Quantitation Limit

RCRA Resource Conservation and Recovery Act

SIM Selected Ion Monitoring

TPH Total Petroleum Hydrocarbons

tr Trace level is the concentration of an analyte that is less than the PQL but greater

than or equal to the MDL.

Inorganic Data Qualifiers

- * The result is an outlier. See case narrative.
- # The control limit criteria is not applicable. See case narrative.
- B The analyte was found in the associated method blank at a level that is significant relative to the sample result as defined by the DOD or NELAC standards.
- E The result is an estimate amount because the value exceeded the instrument calibration range.
- J The result is an estimated value that was detected outside the quantitation range.
- U The analyte was analyzed for, but was not detected ("Non-detect") at or above the MRL/MDL. DOD-QSM 4.1 definition: Analyte was not detected and is reported as less than the LOD or as defined by the project. The detection limit is adjusted for dilution.
- i The MRL/MDL or LOQ/LOD is elevated due to a matrix interference.
- X See case narrative.
- Q See case narrative. One or more quality control criteria was outside the limits.

Metals Data Qualifiers

- # The control limit criteria is not applicable. See case narrative.
- J The result is an estimated value that was detected outside the quantitation range.
- E The percent difference for the serial dilution was greater than 10%, indicating a possible matrix interference in the sample.
- M The duplicate injection precision was not met.
- N The Matrix Spike sample recovery is not within control limits. See case narrative.
- S The reported value was determined by the Method of Standard Additions (MSA).
- U The analyte was analyzed for, but was not detected ("Non-detect") at or above the MRL/MDL. DOD-QSM 4.1 definition: Analyte was not detected and is reported as less than the LOD or as defined by the project. The detection limit is adjusted for dilution.
- W The post-digestion spike for furnace AA analysis is out of control limits, while sample absorbance is less than 50% of spike absorbance.
- i The MRL/MDL or LOQ/LOD is elevated due to a matrix interference.
- X See case parrative.
- + The correlation coefficient for the MSA is less than 0.995.
- Q See case narrative. One or more quality control criteria was outside the limits.

Organic Data Qualifiers

- * The result is an outlier. See case narrative.
- # The control limit criteria is not applicable. See case narrative.
- A A tentatively identified compound, a suspected aldol-condensation product.
- B The analyte was found in the associated method blank at a level that is significant relative to the sample result as defined by the DOD or NELAC standards.
- C The analyte was qualitatively confirmed using GC/MS techniques, pattern recognition, or by comparing to historical data.
- D The reported result is from a dilution.
- E The result is an estimate amount because the value exceeded the instrument calibration range.
- J The result is an estimated value that was detected outside the quantitation range.
- N The result is presumptive. The analyte was tentatively identified, but a confirmation analysis was not performed.
- P The GC or HPLC confirmation criteria was exceeded. The relative percent difference is greater than 40% between the two analytical results.
- The analyte was analyzed for, but was not detected ("Non-detect") at or above the MRL/MDL. DOD-QSM 4.1 definition: Analyte was not detected and is reported as less than the LOD or as defined by the project. The detection limit is adjusted for dilution.
- i The MRL/MDL or LOQ/LOD is elevated due to a chromatographic interference.
- X See case narrative.
- Q See case narrative. One or more quality control criteria was outside the limits.

Additional Petroleum Hydrocarbon Specific Qualifiers

- F The chromatographic fingerprint of the sample matches the elution pattern of the calibration standard.
- L The chromatographic fingerprint of the sample resembles a petroleum product, but the elution pattern indicates the presence of a greater amount of lighter molecular weight constituents than the calibration standard.
- H The chromatographic fingerprint of the sample resembles a petroleum product, but the elution pattern indicates the presence of a greater amount of heavier molecular weight constituents than the calibration standard.
- O The chromatographic fingerprint of the sample resembles an oil, but does not match the calibration standard.
- Y The chromatographic fingerprint of the sample resembles a petroleum product eluting in approximately the correct earbon range, but the elution pattern does not match the calibration standard.
- Z The chromatographic fingerprint does not resemble a petroleum product.

Columbia Analytical Services, Inc. Kelso, WA State Certifications, Accreditations, and Licenses

Program	Number						
Alaska DEC UST	UST-040						
Arizona DHS	AZ0339						
Arkansas - DEQ	88-0637						
California DHS	2286						
Colorado DPHE	-						
Florida DOH	E87412						
Hawaii DOH	-						
Idaho DHW	-						
Indiana DOH	C-WA-01						
Louisiana DEQ	3016						
Louisiana DHH	LA050010						
Maine DHS	WA0035						
Michigan DEQ	9949						
Minnesota DOH	053-999-368						
Montana DPHHS	CERT0047						
Nevada DEP	WA35						
New Jersey DEP	WA005						
New Mexico ED	p.						
North Carolina DWQ	605						
Oklahoma DEQ	9801						
Oregon - DHS	WA200001						
South Carolina DHEC	61002						
Utah DOH	COLU						
Washington DOE	C1203						
Wisconsin DNR	998386840						
Wyoming (EPA Region 8)	-						









CHAIN OF CUSTODY

SR#: (LOD J411

131	7 South 13th	n Ave. • Kelso, \	NA 98626	• (360)	577-7222 •	(800) 6	95-7222	2x07 •	FAX (360) 6	36-106	68	T F	NGE_			лг –				/ #/		
PROJECT NAME St. Godin	F. 7. 7	wet		$\overline{7}$		7	1 ~	7 ,	/ /	/ /	/ /	1 0	/ /	7	/			/	/ _ /	/ /	' /	1	$\overline{/}$
PROJECT NUMBER 3471				$\overline{}$	/	1. 1			- /5	9/		BISTAL				, G	$i \int_{C}$. /	20905			///	/
PROJECT MANAGER PRESTON Stage COMPANY/ADDRESS HOTZON ET	4 S			$ \longrightarrow $. / /	Janics 8270LCMS	B	_/	1664 SGT	7	_ /	9			1-	788, PO F. F. NO.	يَ/كِ	Ί,	3/			/ /	l
COMPANY ADDRESS HOT 2011 ET	grner -	i\n^4		3 OF CONTAINERS		57	Call below)		664	/ /			9/_	/2	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	4.0] [₹]	40x 1650 C	J/		/	/ /	ŀ
13 35 NE W	Hake	- Who		J ₹	1 /8	\\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\	1 pg		/	/ £	8.8	12.5		100	5	122/	√. S			/ .	/ /	/ /	
CITYISTATEZIP DIVILIREN & COLD	972	130 J] § [leg l	1/8/1		le in			100	β. /	(2)	ž /	\$ E	20/5	Ó	\ \disp\{	' /			/	
E-MAIL ADDRESS A DOSTIZON	engine	coing , Ca	is L	12/	10%						Z/Z		0 to		`\o;		V Je				_/	/	j
202-723-2020	FAX#		/	5	Jago /	9			\mathcal{I}	ું ફ્રિફે	8/8	10/ 8	8/5		[\begin{align*}	3/8) [æ/				/	
SAMPLER'S SIGNATURE			/_	WMBER	Semivolatile 625 [] B27			-\ \@ \ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \				7/ £	tals.	Cyanide [7]	/g	(\$\disp\	70 XOZ	7	/	/	/	/	
SAMPLE I.D. DATE	TIME	LAB I.D. MA	TRIX / 3	₹	/8 /2	\$\frac{1}{2}\cdot\cdot\cdot\cdot\cdot\cdot\cdot\cdot	True Finge	(ð	\5₹	148	10 E	PAHS OF PERSON BY	Metals, Total OSIM []	ੋਂ ∕ੋਂ ∕	& .</td <td>12 100 100 100 100 100 100 100 100 100 1</td> <td>2/</td> <td></td> <td>/ /</td> <td></td> <td>/ /</td> <td>/ REMAR</td> <td>iks</td>	12 100 100 100 100 100 100 100 100 100 1	2/		/ /		/ /	/ REMAR	iks
Run 1 Filter 3/11/10		Ad	1 1									[X										
Run 2 Filter 3/11/10		•		2							Ì		X										
Run 3 Filter 3/11/10			1										X									_	
Filter Blanks 3/11/10			1										Ϋ́	1			\neg			\neg			
Run / Front Rinse 3/11/10			1	i i i									χ										
Pun 2 Front finse 3/11/10													'X							\neg			
Run 3 Front Rinse 3/11/10			i										X							\neg			
Run I ImpingaiRus 3/1/10													X	\neg			_			\neg			
Run 2 Imp. + Rinse 3/11/10													×				1						
Run 3 Imp. + RV6 3/11/10		1	V .										>										
REPORT REQUIREMENTS	INVO	ICE INFORMA	TION	Circle	which meta	ils are to	be anal	lvzed.								<u> </u>					ļ		
I. Routine Report: Method	P.O. # _	3/12 Emby B	5-1-1	To	tal Metals: /	Al As	Sb Ba	a Be	ВСа	Cd	Co Å	Sr) Cu	Fe I	Pb Mo	ı Mn	Mo	Ni K	(Αα	Na	Se Sr	· Ti 5	Sn V Z⊓	На
Blank, Surrogate, as	Bill to:	Emmy 1	-Jwer	``							_											Sn V Zn	i
nequired																							пy
II. Report Dup., MS, MSD as	TURNAR	OUND REQUI	REMEN]	S SDE	ICATE ST CIAL INST				UN FIT	OUEL	JUNE	. AN	. <u>UA</u>	VVI	NON	11777	31	Λ.	:n:		_ (C)tr	CLE ONE)	
/ required		or48		- J.	CIAL INST		21437C	زرت ک	E14.1 S.	di Ce	44	4	CEV2	- t	50	AA	<u>.1</u>	110	alz	 i+1	clu	dl	
III. Data Validation Report	5 D			7-10	a di	ر موسط مستار موسط	. 145		1.		1/15												
(includes all raw data)		ndard (10-15 wo	rking days	३ िंग	A Comment	103	PO 1 1 - 2		M	A A	1												
IV. CLP Deliverable Report	/	vide FAX Result																					
V. EDĐ				_																			
	Re	quested Report	Date																				
RELINQUISHED BY:	مراوي	- Bull	F RE	CEIVED	150	94	<u> 5</u>	L	. , 1	REL	INQU	JISHEI			. د ال				RE	CEIVE			
Slower 5/19/1	074	> Survey			100	411-	_ t	d <u>ji</u>)4/1			اك_	51D	D	40			<u>S</u> .			3/15	10 12	40
Signature Helfeman Bate/Time	1701	Signatur	wind	L	ate Fime			Sign	najurė 1) / (s ited) :			Ua ()	S ^{Tim}	e		}	igna خے	iure Ken	nede	i	Date	ime	
Printed Name Firm		Printed t	vame		-irm	_	-	nn-	ited/N	ame		- Ť ir	m			1	rinte	d Nar	ne _		<u>C</u> A Firm		

TA	Columbia	
Charles D.	Columbia Analytical	Services*

CHAIN OF CUSTODY

SR#: KUD JYII

COC# 1317 South 13th Ave. • Kelso, WA 98626 • (360) 577-7222 • (800) 695-7222x07 • FAX (360) 636-1068 PROJECT NAMESTI GEGA IN 81514 PROJECT HUMBER 3472 NUMBER OF CONTAINERS Metals, Total or Dissolved Thorzon consider no. Com PHONE \$73-258-5050 REMARKS TIME LAB I.D. MATRIX D.IN HNO3 Black 3/u/10 X INVOICE INFORMATION Circle which metals are to be analyzed: REPORT REQUIREMENTS Total Metals: At As Sb Ba Be B Ca Cd Co Cr Cu Fe Pb Mg Mn Mo NI K Ag Na Se Sr Tl Sn V Zn Hg BIII TO: GUNIA I. Routine Report: Method Blank, Surrogate, as Dissolved Metals: At As Sb Ba Be B Ca Cd Cc Cr Cu Fe Pb Mg Mn Mo Nt K Ag Na Se Sr Tt Sn V Zn Hg required 'INDICATE STATE HYDROCARBON PROCEDURE: AK CA WI NORTHWEST OTHER: (CIRCLE ONE) Report Dup., MS, MSD as TURNAROUND REQUIREMENTS SPECIAL INSTRUCTIONS/COMMENTS: required ___ 24 hr. III. Data Validation Report 5 Day (includes all raw data) Standard (10-15 working days) IV. CLP Deliverable Report Provide FAX Results __ V. EDD Requested Report Date HEL/INDUISHED, BY: RECEIVED BY: 315-09 9:45 RECEIVED BY: 3/15/10 1240

Analytical Report

Client:

Horizon Engineering, LLC

Project:

Sample Matrix: Misc.

St. Gobain F5 Inlet/3472

Service Request: K1002411 . Date Collected: 03/11/10

Date Received: 03/15/10 Date Extracted: 03/30/10

Total Metals Units: Micrograms (µg) (Field Blank Corrected)

	Sample Name:		Front Half Run - 1 (Analytical Fraction IA)		Back Half Run - 1 (Analytical Fraction 2A)		Total Front Half + Back Half
	Lab Code:		K1002411-001,-005		K1002411-008		-
	Date Analyzed:		04/02/10		04/02/10		-
Analyte	EPA Method	Front Half MRL		Back Half MRL		Total MRL	
Analyte	MERHON	MIKE		WINL		WINE	
Chromium	29/200.8	1.0	972	0.1	13.8	1.1	986

Analytical Report

Client:

Analyte Chromium Horizon Engineering, LLC St. Gobain F5 Inlet/3472

Project: Sample Matrix: Misc.

29/200.8

1.0

1520

Service Request: K1002411

3.5

Date Collected: 03/11/10

Date Received: 03/15/10 Date Extracted: 03/30/10

1.1

1520

Total Metals

Units: Micrograms (µg) (Field Blank Corrected)

Sample Name:		ront Half Run - 2 nalytical Fraction 1A)		Back Half Run - 2 (Analytical Fraction 2A)		Total Front Half + Back Half
Lab Code:	K	1002411-002,-006		K1002411-009		•
Date Analyzed:		04/02/10		04/02/10		-
	Front	,	Back			
EPA	Half		Half		Total	
Method	MRL		MRL		MRL	

0.1

Analytical Report

Client: Horizon Engineering, LLC
Project: St. Gobain F5 Inlet/3472

Sample Matrix: Misc.

Service Request: K1002411
Date Collected: 03/11/10
Date Received: 03/15/10
Date Extracted: 03/30/10

Total Metals Units: Micrograms (µg) (Field Blank Corrected)

	Sample Name:		Front Half Run - 3 (Analytical Fraction 1A)		Back Half Run - 3 (Analytical Fraction 2A)		Total Front Half + Back Half
	Lab Code:		K1002411-003,-007		K1002411-010		~
	Date Analyzed:		04/02/10		04/02/10		-
Analyte	EPA Method	Front Half MRL		Back Half MRL		Total MRL	
Chromium	29/200.8	1.0	1580	0.1	5.7	1.1	1590

Analytical Report

Client: Project: Horizon Engineering, LLC St. Gobain F5 Inlet/3472

Sample Matrix: Misc.

Service Request: K1002411

Date Collected: 03/11/10 Date Received: 03/15/10

Date Extracted: 03/30/10

Total Metals Units: Micrograms (µg)

	Sample Name: Lab Code; Date Analyzed:		Front Half Blank (Analytical Fraction IA) K 1002411-004,-011 04/02/10		Back Half Blank (Analytical Fraction 2A) K1002411-011,-012 04/02/10
Analyte	EPA Method	Front Half MRL		Back Half MRL	
Chromium	29/200.8	1.0	ND	0.1	0.5

Analytical Report

Client:

Horizon Engineering, LLC

Service Request: K1002411

Project:

Chromium

St. Gobain F5 Inlet/3472

Date Collected: NA

Sample Matrix: Misc.

Date Received: NA Date Extracted: 03/30/10

Total Metals Units: Micrograms (µg)

Method Blank -

Method Blank -

Sample Name:

Front Half

ND

Back Half

Lab Code: Date Analyzed:

29/200.8

K1002411-MBF

K1002411-MBB

04/02/10

04/02/10

EPA Analyte Method

Front Half MRL 1.0

MRL 0.1

Back

Half

0.1

QA/QC Report

Client:

Horizon Engineering, LLC

Project:

St. Gobain F5 Inlet/3472

Sample Matrix: Misc.

Service Request: K1002411

Date Collected: 03/11/10 Date Received: 03/15/10

Date Extracted: 03/30/10

Date Analyzed: 04/02/10

Duplicate Summary Total Metals Units: Micrograms (µg)

(Field Blank Corrected)

Sample Name:

Back Half Run - 1 (Analytical Fraction 2A)

Lab Code:

K1002411-008D

				Duplicate		Relative
	EPA		Sample	Sample		Percent
Analyte	Method	MRL	Result	Result	Average	Difference
Chromium	29/200.8	0.1	13.8	13.6	13.7	1

QA/QC Report

Client:

Horizon Engineering, LLC

Project:

St. Gobain F5 Inlet/3472

Sample Matrix: Misc.

Service Request: K1002411 Date Collected: 03/11/10 Date Received: 03/15/10

Date Extracted: 03/30/10 Date Analyzed: 04/02/10

Matrix Spike Summary

Total Metals

Units: Micrograms (µg) (Field Blank Corrected)

Sample Name:

Lab Code:

Analyte Chromium

Back Half Run - 1 (An K1002411-008S	alytical Fractic	n 2A)				CAS Percent
	MRL	Spike Level	Sample Result	Spiked Sample Result	Percent Recovery	Recovery Acceptance Limits
	0.1	7.9	13.8	22.3	108	70-130

QA/QC Report

Client:

Horizon Engineering, LLC

Project:

St. Gobain F5 Inlet/3472

LCS Matrix:

Water

Service Request: K1002411

Date Collected: NA

Date Received: NA

Date Analyzed: 04/02/10

Laboratory Control Sample Summary (Front Half)

Total Metals Units: µg/L (ppb)

Source:

CAS Spike Solution

CAS

Percent Recovery

EPA True Percent Acceptance Analyte Method Value Result Limits Recovery Chromium 100 29/200.8 101 101 85-115

QA/QC Report

Client: Project: Horizon Engineering, LLC St. Gobain F5 Inlet/3472

LCS Matrix:

Water

Service Request: K1002411

Date Collected: NA
Date Received: NA

Date Analyzed: 04/02/10

Laboratory Control Sample Summary (Back Half)

Total Metals Units: μg/L (ppb)

Source:

CAS Spike Solution

CAS

Percent Recovery **EPA** True Percent Acceptance Limits Method Value Result Recovery Analyte 20 21.2 106 85-115 Chromium 29/200.8

Traverse Point Locations

Saint Gobain Containers 11-Mar-10
Furnace #5, CC Inlet PS
Seattle, WA 3472
EPA 1 mew

Outer Circumference	Co	in							_
Wall thickness	t	in							
INSIDE of FAR WALL	F	in	42.	00		Down S	stream		
to OUTSIDE of Nipple							———Dist	urbance	
INSIDE of NEAR WALL	N	in		6	1				
to OUTSIDE of Nipple					A		Рол		
STACK WALL to	N-t	in				Ds	Z N S I		
to OUTSIDE of Nipple					T	- F	N	G	o
DOWNstream Disturb	A	in	73	.0				-	O.
UPstream Disturb	В	in	94	.0					/ G
Inner Diameter	Ds	in		36				1	h.
Area	As	sqin	1017	.9	В				1
DOWNstream Ratio	A/Ds	•	2.)3	1	Λ		3	-
UPstream Ratio	B/Ds		2.	51		Flow			1
									1
Minimum #Pts (Particulate)			;	24					
Minimum #Pts/Diameter				.2			———Dist	urbance	
Minimum #Pts (NON-Particu	late)			6	,	/ /	\		
Minimum #Pts/Diameter				8	/	Up Stream	n \		
Actual Points per Diameter				2	/		\		
Actual Points Used				!4	/	<u> </u>			
Trav	Fract	Stack	Actual	Near	rest	Adjusted	Traverse	Travers	e
Pt	Stk ID	ID	Points	8ths		Points	Points	Points	
#No	(f)	(Ds)	(Dsxf)	(TP)	•	(TP)	(TP + N)	(TP + N	1)
1	2.13%	36.0	0	.8	0.75	1	7	7	
2	6.70%	36.0		.4	2.375	2.375			/
3	11.81%	36.0		.3	4.25	4.25		10 1	
4	17.73%	36.0	6	.4	6.375	6.375	12.375	12 3	
5	25.00%	36.0	9	.0	9	9	15	15	
6	35.57%	36.0	12	.8	12.75	12.75	18.75	18 3	1
7	64.43%	36.0	23	.2	23.25	23.25	29.25	29 1	/
8	75.00%	36.0	27	.0	27	27	33	33	
9	82.27%	36.0	29	.6	29.625	29.625	35.625	35 5	/
10	88.19%	36.0	31	.7	31.75	31.75	37.75		/
11	93.30%	36.0	33	6	33.625	33.625	39.625	39 5	1
12	97.87%	36.0	35	_	35.25	35	41	41	



13585 NE Whitaker Way • Portland, OR 97230 Phone (503) 255-5050 • Fax (503) 255-0505 www.horizonengineering.com

TRAVERSE POINT LOCATIONS WORKSHEET

Client & Source Sain + Gratain	·	
Sampling location Furnace #5	CC. Inlest	
Date Para 10 Initials PS		

Traverse	Traverse Point
Point	Location
Number	(inches)
1	7_
2	8 3/8
3	101/4
4	123/8
5	15
6	183/4
7	291/4
8	33
9	35 1/8
10	373/4
11	3734 395/8
12	4/1

Duct Dimensions and Port Locations
Inside of far wall to outside of nipple, F
Inside of near wall to outside of nipple, N
Nearest downstream disturbance, A73
Nearest upstream disturbance, B94"
Circular: Inside Diameter, F-N
Rectangular: Width " Depth"
Number of Ports: 2

Circle duct characteristics:
Construction: Steel, PVC, Fiberglas, Other
Shape: Circular Rectangular
Orientation: Vertical, Horizontal
Flow straighteners: Yes (No
Extension: Yes (No.)
Cyclonic Flow Expected: Yes No
Cyclonic Flow Measured Yes No
Average Null Angle <20° (Yes No
Meets EPA M-1 Criteria Yes No

Test port sketch o	or comments		



13585 NE Whitaker Way • Portland, OR 97230 Phone (503) 255-5050 • Fax (503) 255-0505 www.horizonengineering.com

Tedl	ar E	lag /	۱nal	ysis	Data	Sheet
				,		

Client: St. Gala A
Leak Checks: Pre-test_ Post-test Job No.:

3472

Tester:

Test Date:

		Cylinder No.	Cylinder	Start	End
			Value	Response	Response
Time:	12:45				
Gas: O2		0-14	22.26	22,3	22,3
Range 9-25					
Analyzer Model	Secumer 1400				
Analyzer SN.	000012			,	
Gas: CO2		22	12.38	12.4	12.4
Range (0-25			* 1	•	
Analyzer Model	SErvomevino		,		
Analyzer SN.,	000050			,	,
Gas: 02/C02	11	0-10	11.5/10	11,4/0	11.4/0
Range				/	/
Analyzer Model					
Analyzer SN.			,	,	,
Gas: C02/02	17	1.1	6.01/0	5,9/0	5.9/0
Range 17-25			. ,		/
Analyzer Model					
Analyzer SN.					

				· Analysis							
	Bag		O ₂	CO2	СО	NOx	VOC	SO ₂			
Sample ID:	Appearance:	Time:	%	%	ppm	ppm	ppm	ppm			
Run#1 Run#3		13:00	19.0	3,6							
Run#2		13:05	19.2	3.0							
Run#3		16151	19.0	3,8							
							-				
		•									
						,					
				_			, ,				
	<u> </u>										

Describe Sampling Setup: Ted lac	Borgs	pulled	from	fre	prefer box	΄ ι

Production/Process Data Furnace Operating Data

Saint-Gobain Containers, Inc., Seattle Plant

Furnace Operating Data March 11, 2010

Test Times	3/11/2010
Run 1	08:25 - 10:28
Run 2	10:50 – 13:57
Run 3	14:10 – 17:16
Run 4	NA NA
Run 5	NA
Furnace #	5
Pull Rate (Tons Glass/Day)	75.2
Gas (scfh)	14514
Oil (gal/hr) #2 Ultra-low Sulfer Diesel	0
Oxygen (scfh)	25743
Air (scfh)	0
Electric Boost (kW)	1086
Bridgewall Temp (F)	2681
Cullet Ratio (%)	31
Glass Color	Emerald Green

Calibration Information

Meter Box
Calibration Critical Orifices
Standard Meter
Pitots
Shortridge Micromanometer
Thermocouples and Indicators
Barometer
Calibration Gas Certificates

Biannual Meterbox Calibration

Method Location Meter Box ID Meter ID calibrated by	eter Box ID 4				-	0.0 0.0	Date : Pb= : Ta= ! Tamb ! in/min @ : in/min @ :	54 514 28.00	(in Hg) (oF)				Old 8/3/09 0.97351 1.68544	New 1/15/10 0.98392 1.65610	Change (+/-) 1.1% -1.8%	pass
					Positive	0.0	Field	Meter	inches Hzu		Time	1				
	VAC (in Hg)	Critical Orifice ID	К	dH (inH2O)	Meter (ft3)	Net (ft3)	Tdi (oF)	Tdo (oF)	To (oR)	Tm (oR)	t (min)	Υ	dH@	Y	dH@	
leitiel	18.0	EE 0	0.46025	1.10	224 8500	F 4400	F0.0	F7.0	F47.01	F47.F	0.00	0.00404	4.00547	0.020		Allow. Tolerance
Initial Final	10.0	55.0	0.40025	1.10	334.8500 340.2980	5.4480		57.0 57.0		517.5	9.00	0.98121	1.62547			11
Initial	14.5	63.0	0.59166	1,80		5.0160	58.0 59.0	57.0		518.5	6.50	0.98967	1.63666	0.006	pass 0.02	
Final	14.5	03.0	0.55100	1,00	345.3140		61.0	57.0	11 .	510.5	0.50	0.86807	1.03000	pass	pass	II .
Initial	16.5	73.0	0,81187	3.60	1		<u>'</u>	57.0		520.8	5.50	0.98088	1.70616		0.05	
Final					351.1900		66.0	58.0	"	220.0	0.00	5.55555	.,. 5510	pass		
							'					0.98392	1.65610	0.00230		

Post Test Meterbox Calibration

Method EPA M-5 #7.2 Location Date 03/12/2010 Shop Pb= 29.70 Change Meter Box 4 (in Hg) Biannual Post-Test calibrated by PT (oF) Ta≃ 60 1/15/10 03/12/2010 (+/-) Tamb 520 (oR) Υ= 0.98392 0.98145 -0.3% pass dH@= 1.65610 1.80775 8.4% Meter Field Time VAC Critical κ dΗ Tdi Tdo То Meter Net Tm (in Hg) Orifice ID (inH2O) (oF) (oR) Υ (ft3) (ft3) (oF) (oR) (min) Υ dH@ dH@ 0.020 0.20 Allow, Tolerance Initial 19.0 63.0 0.59166 1.90 983.5390 6.9180 55.0 57.0 515.5 515.5 9.00 0.98180 1.81136 0.000 0.00 Final 990.4570 56.0 54.0 pass pass 63.0 0.59166 515.3 initial 19.0 1.90 990.4570 5.3870 56.0 54.0 514.5 7.00 0.98017 1.81062 0.001 0.00 55.0 Final 995.8440 56.0 pass pass initial 19.0 63.0 0.59166 1.90 995.8440 8.4790 56.0 55.0 515.5 517.3 11.00 0.98239 1.80126 0.001 0.01 1004.3230 56.0 Final 62.0 pass pass 0.98145 0.00051 0.00259 1.80775

							•		
Method Location Meter Box Meter ID Calibrated by	Hor: - 4 1032	-5#7.2 250 3994			Date Pb= Ta= Leak Check Rate	29.		(in Hg) (oF)	-
	VAC (inHg)	Critical Orifice	K	dH inH2O	Meter (ft3)	Field Tdi (oF)	Meter Tdo (oF)	Time t (min)	
Initial Final Initial Final Initial Final Final	19	63	,59164	1.9	983,539 990:457 990:457 995.844 995.844 4,323	55 56 59 59	57 54 54 55 55 55	9 7 11	
*If the box leaks Be sure to upda **You must col ****For post-test of Make 3 runs of 5 of Comments:	te new K lect at le alibrations	values from ast 5 cuft.	m annual c	alibration	s when entering	g data int	o spreads	sheet.	ent it.
Method Location Meter Box Meter ID Calibrated by	EPA M	-5 #7.2			Date Pb= Ta= Leak Check Rate			(in Hg) (oF) in/min	
	VAC (inHg)	Critical Orifice	K	dH inH2O	Meter (ft3)	Field Tdi (oF)	Meter Tdo (oF)	Time t (min)	
initial Final Initial									

Comments:

Final Initial Final

^{*}If the box leaks or doesn't calibrate for any reason please let report writer know ASAP and document it. Be sure to update new K values from annual calibrations when entering data into spreadsheet.

^{**}You must collect at least 5 cuft.

^{****}For post-test calibrations in field (New 10.3.2, Old 5.3.2) Select crifice nearest to operational conditions Make 3 runs of 5 cuft each.

Critical Orifice Calibrations

Set Job#	Shop #1 in house		_						_	Horizon Er	ngineering Whitaker W	
Date:	12/1/09									Portland, C		ay
DGM (Y) =	0.99633				_					,	3) 255-5050	
DGM ID#	standard						/		_	•	3) 255-5050 3) 255-0505	
	PMW		*** Minim	ım 5 minat	e Runs ***					YAX (50.	0) 455-0505	
Dry Gas Meter Orifice ID # 73 V Orifice ID # 63 V Orifice ID # 55 Orifice ID										# 48	Orifice ID	¥ 40
K' Critical Orifice Coef	ficient		0.81187		0.59166	•	0.46025		0.34725		0.23720	, I
	Symbol	Units		Run 2		Run 2		Run 2		Run 2	Run 1	Run 2
Initial volume	Vi	ft ³	505.275	512.687	537.823	545.637	498.675	501.673		496.184	488,100	491.027
Final Volume	Vf	ft³	512.687	521.176	545.552	550.658	501.673	505.275	496.184	498.675	491.027	492.574
Difference	Vm	ft³	7.412	8.489	7.729	5.021	2.998	3.602	3.611	2.491	2.927	1.547
Temperatures								_		_		
Ambient		°F	56.2	56.2	56.4	56.2	56.2	56.2	55.6	55.8	55.4	55.2
Absolute ambient	Ta	°R	515.9	515.9	516.1	515.9	515.9	515.9	515.3	515.5	515.1	514.9
Initial Inlet	Ti	°F	66.9	74.3	65.3	68.9	66.8	66.0	62.2	63.9	62.2	62.5
Outlet	\mathbf{Tf}	${}^{\circ}\mathrm{F}$	58.4	59.3	58.8	59.3	58.0	58.0		57.5	57.1	57.2
Final Inlet	Ti	۰F	76.5	77.9	71.4	71.8	64.6	68.0	64.0	64.7	62.3	62.1
Outlet	Tf	°F	59.4	60.4	59.4	59.6	57.7	58.3	57.5	57.7	57.2	57.2
Avg. Temp	Tm	°R	525.0	527.6	523.4	524.6	521.4	522.2	519.9	520.6	519.4	519.4
Time		min	7	8	10	6	5	6	8	5	9	5
		sec	0	0	0	30	0	0	0	30	30	0
			7.00	8.00	10.00	6.50		6.00	8.00	5.50	9.50	5.00
Orifice man. rdg	\mathbf{dH}	in H2O	4.200	4.200	2.200	2.200	1.300	1.300	0.710	0.710	0.320	0.320
Barometric. Pressure	Pbar	inĤg	30.55	30.55	30.55	30.55	I	30.55	30.55	30.55	30.55	30.55
Pump vacuum		inHg	12.0	12.0	15.0	15.0	17.0	17.0	18.0	18.0	19.0	19.0
K' factor			0.81307	0.81068	0.59255	0.59078	0.46033	0.46018	0.34687	0.34763	0.23674	0.23767
K' factor Average				0.81187		0.59166	1	0.46025		0.34725		0.23720
% Error (+/- 0.5)		%		0.15%		0.15%		0.02%		0.11%		0.20%
Vcr(std)			7.6554	8.7233	7.9686	5.1651	2.00=0	0.7400	0.7047	0.5707	0.0075	4 5000
Vm(std)			7.6836	8.7554	7.9980	5.1841	3.0958 3.1072	3.7138 3.7275		2.5727 2.5822	3.0275 3.0386	1,5999 1,6058
Υ .			0.9963	0.9963	0.9963	0.9963	0.9963	0.9963	0.9963	0.9963	0.9963	0.9963



13585 N.E. Whitaker Way • Portland, OR 97230 Phone (503)255-5050 • Fax (503)255-0505 www.horlzonengineering.com

Standard Meter Calibration ID# 2299046 Northwest Natural, Gas Meter Division

. \$	SET [NEW METER I	INWBER	SIZE		PERF #			NEW ERT#		1Ņ	DEX READI	NG	,
.0	CHANGE	OLD METER N	UMBER	SIZE		OLD PER	#		OLD ERT#		OI	D INDEX R	EADING	
F	EMOVAL								<u></u>					
-	SERVICE	ADDRESS			SPA	ACE OR A	PT NO.					CITY		
_	METER	LEFT EQU	JIP LEFT	CUR	B LEFT	CUS	T VALV	E	LOC	INS.	B5.	_	BW.	PDL
	ON	OFF ON	OFF	ÓN	OFF	40	off							
_	GREEN	TAG YELL	DW TAG	TIED	NOT	М	TŘ	6.5 INW	C @ 130 CFH	2	LB		OVER 2L	В
	YES	NO YES	e No		TIED	PRES	SURE			_				
	REMAR	KS	Met	PV	te	540		4+	3	100	ت د	rat	<i>e5</i>	
) ! _	only	_										_		_
_	- 1													
,=	Comple	ted By:								Date:				
									g.	•	FOR METE	R SHOP OI	VLY .	
4-	METER	WRONG	INDEX	(DR	M	ETER	4	co	MMENTSALES	T CODES		NEDW NG	TESTS.
	SAMPLE	SIZE	IMPAIRI 3	ED	4	IMP	AIRED 6	4	800	1_9	9.6	D	PEN	
-	- CDT	2		-		DE	VIAND	HOR METER	0,0	0 .		C	HECK	
	ERT DAMAGE	LEAK	SET WRO	NG.	LIQUIDS 15	Ŧ	EST	CHANGES	600	1- 9	9.6			
_	7	8	14	Д.	12		18	REMOVAL	.5	0		IN	DEX READ	ERTREAD
	OTHER	CORROSIO	NO USE	PCC	Unauth Gas/Var		FIRE	ONLY	20	- 0	9.7			
•	19	29	21	24	2		28	•	TEST DA	IE INITIA	L5 ME	TER		
_	F-8735 I	METER RECORD	(Rev 0807)			F	ART 1		696	9 to	n	5-7	75	
_		 							PARKET PARKET	- 17/-27-27-2	Walter and all		7	

		#2 sec 4 WT			Whitaker Shor							D0 -4	D-I-	0-	-
Pitot	Date Tested	Ср	5	Pitot	Date Tested	Ср	S	Pitot	Date Tested	Ср	s	Pilat	Date Tested	Ср	S
3-1	9/29/2009	0.8268	0.001	3-8	9/29/2009	0.8328	0.002		7-5-12-2	_		4-7	9/28/2009	0.7871	0.009
3-2	10/1/2009	0.8375	0.003		9/29/2009	0.8195	0.002	4-2	9/29/2009	0.8290	0.003		9/29/2009	0.8380	0.002
3-3	9/29/2009	0.8370	0.004		9/29/2009	0.8328	0.002	4-3	9/29/2009	0.8392	0.000		9/29/2009	0.7971	0.005
3-4	9/29/2009	0.8233	0.004	3-11	9/29/2009	0.6168	0.003		9/29/2009	0.8346	0.005		9/29/2009	0.8173	0.002
3-5	9/29/2009	0.8056	0.002				0.004	4-6	9/29/2009	0.8254	0.003		10/5/2009	0.8274	0.003 0.006
3-6	9/29/2009	0.8227	0.004 0.006	3-13	9/29/2009 10/26/09	0.8103 0.8092	0.004 0.004	4-Б	9/29/2009	0.8259	0.005	4-12	10/5/2009	0.7914	0.000
3-7	10/5/2009	0.8210 DpP	DpS	Ср	d\$	Ave Cp	S 5.004	_		DρP	DpS	Ср	ď\$	Ave Cp	S
		(P-Type)	(S-Type)	СР	u.s	Ave op	<0.01	l		(P-Type)	(S-Type)				< 0.01
	3-1	0.320	0.460	0.8257	0.001	0.8268	0.001	 							
Status	Pass	0.620	0.890	0.8263	0.000			Status							
Date	9/29/2009	1.050	1.500	0.8283	0.002			Date							- 1
Tester	PS							Tester							
	3-2	0.350	0.490	0.8367	0.001	0.8375	0.003	l	4-2	0.320	0.460	0.8257	0.003	0.8290	0.003
Stalus	Pass	0.665	0.920	0.8417	0.004	0.0010	0.000	Status	Pass	0.630	0.890	0.8329	0.004		
Date	10/1/2009	1.100	1.550	0.8340	0.003			Date	9/29/2009 /	1.050	1.500	0.8283	0.001		
Tester	JL							Tester	PS 🦸						
l								l	1	0.000	0.400	0.0006	0.001	0.8392	000.0
l	3-3	0.330	0.460	0.8385	0.002	0.8370	0.004	Pietes	4-3 ·V	0.330 0.640	0.460 0.890	0.8385 0.8395	0.000	0.0382	0.000
Status Date	Pass 9/29/2009	0.640 1.100	0.910 1.520	0.8302 0.8422	0.007 0.005			Status Date	Pass 9/29/2009	1.100	1.530	0.8394	0.000		
Tester	PS	1.100	1,020	0.0422	0.003			Tester	PS		11200	•			
, 65,51								I							1
ľ	3-4	0.350	0.510	0.8201	0.003	0.0233	0.004	l	4-4	0.340	0.470	0.8420	0.007	0.8346	0.DO5
Status	Pass	0.680	0.970	0.8289	0.006			Status	Pass	0.650	0.930	0.8277	0.007		I
Date	9/29/2009	1.100	1.600	0.8209	0.002			Date	9/29/2009 PS	1.100	1.550	0.8340	0.001		- 1
Tester	PS							Tester	F3						- 1
	3-5	0.330	0.500	0.8043	0.001	0.8056	0.002	l	4-5	0.320	0.460	0.8257	0.000	0.8254	0.003
Status	Pass	0.640	0.970	0.8042	0.001			Status	Pass	0.660	0.940	0.8296	0.004		
Date	9/29/2009	1.100	1.650	0.8083	0.003			Date	9/29/2009	1.100	1.600	0.8209	0.005		- 1
Tester	PS							Tester	PS						- 1
l				0.0000	0.005	a 2227	0.004	l	4-6	0.340	0.490	0.B247	0.001	0.8259	0.005
Pa-tur-	3-6	0.350	0.500	0.8283 0.8189	0.00 6 0.004	0.8227	0.004	Status	Pass	0.650	0.950	0.8189	0.007	0.0235	0,000
Status Date	Pass 9/29/2009	0.650 1.100	0.950 1.600	0.8209	0.002			Date	9/29/2009	1.100	1.550	0,8340	0.008		
Tester	PS	1.100	12000	0.02.00	0.002			Tester	PS /						
1.00101	, .								• /						
l	3-7	0.330	D.47D	0.8296	0.009	0.8210	800.0		4-7 V	0.190	0.290	D.B013	0.014	0.7871	0.009
Status	Pass	0.640	0.950	0.8126	0.008			Status	Pass	0.450	0.720	0.7627	0.004 0.010		- 1
Date	10/5/2009	1.100	1,600	0.8209	0.000			Date Tester	9/28/2009 PT	0.740	1.200	0.7774	0.010		- 1
Tester	PS							i estei	-,						
l	3-8	0.330	0.470	0.8296	0.003	0.8328	0.002	l	4-B	0.310	0.430	0.8406	0.003	0.8380	0.002
Status	Pass	0.640	0.900	0.8348	0.002			Status	Pass	0.600	0.840	0.0367	0.001		
□ate	9/29/2009	1.100	1.550	0.8340	0.001			Date	9/29/2009	1.000	1.400	0.8367	0.001		
Tester	P\$							Tester	PS						ſ
l	2.0	0.000	0.480	0.8209	0.001	0.8195	0.002	l	4-9	0.320	0.500	0.7920	0.005	0.7971	0.005
Status	3-9 Pass	0.330 0.640	0.940	0.8169	0.003	0.0183	0.002	Status	Pass	0.620	0.940	0.8040	0.007		
Date	9/29/2009	1.100	1.600	0.8209	0.001			Date	9/29/2009	1.000	1.550	0.7952	0.002		
Tester	P\$							Testar	PS						
1								I				0.0404	0.004	0.0477	0.000
l.	3-10	0.330	0.470	0.8296	0.003	0.8328	0.002		4-10 Barn	0.340	0.500	0.8164 0.8146	0.001	0.8173	0.002
Status	Pass	0.640	0.900	0.8348	0.002 0.001			Status Date	Pass 9/29/2009	0.650 1.100	0.960 1.600	0.8209	0.003		
Date Tester	9/29/2009 PS	1.100	1.550	0.8340	0.001			Tester	PS	1.100	1.000	0.0200	0.001		
resier	F-5]							
ì	3-11	0.330	0.480	0.8209	0.002	0.8188	0.003		4-11	0.310	0.440	0.8310	0.004	0.8274	0.003
Status	Pass	0.650	0.960	0.8146	0.004			Status	Pass	0.610	0.870	0.8290	0.002		
Date	9/29/2009	1.100	1.600	0.8209	0.002			Date	10/5/2009	1.000	1.450	0.8222	0.005		- 1
Tester	P\$							Tester	P\$						- 1
l								l	4-12	0.320	0.490	0.8000	0.009	0.7914	0.006
Status								Status	Pass	0.620	0.970	0.7915	0.000		
Date								Date	10/5/2009	1.000	1.600	0.7827	0.009		
Tester								Tester	PS						
l						0.0105		I							
l	3-13	0.340	0.500	0.8164	0.006	0.8103	0.004	I							J
Status Date	Pass 9/29/2009	0.650 1.100	0.980 1.650	0.8063 0.8083	0.004 0.002			I							l
Tester	PS PS	1.100	1.000	0.0000	0.004			I							
								1							
1	3-14	0.340	0.515		0.005	0.8092	0.004	l							
Status	Pass	0.635	0.955		0.002			I							
Date	10/26/09	1.100	1.620	0.8158	0.007			I							
Tester	JL														

Month:	Jan, Fab	Toslera:	PT, PTH, NY,	PW, JMH		Locations	Horizon Shap			
Thermocouple	Channel	Standard, F	Ambient Measured, F		Standard, F	220 +/- Mansured, F		Standard, F	400 +/- Measured, F	Difference 5
Meler Box 4 1/15/2010	STACK PROBE	100 100	29 100	0.18% 0.00%	200 200	199 200	0.15% 0.00%	400 400	399 400	0.125 0.005
	FILTER	100 100	100 99	0.00%	200 200	199 199	0.15% D.16%	400 . 400	399 399	0.129 0.129
	IMPINGER METER IN	100	102	-0.38%	200	202	-0.30%	400	402	-0.239
Meter Box 5	METER OUT STACK	100 50	102 48	-0.35% 0.30%	200	202 197	-0.30% 0.45%	408	402 395	-0.231 0.479
2/3/2010	PROBE	50	52	-0.30%	200	193	1.06%	400	396 391	0.479
	FILTER IMPINGER	50 60	5D 60	%00.0 %00.0	200 200	199 202	0.16% -0.30%	400 400	400	1.055 0.005
	AUX METER IN	50 50	50 48	0.00% 0.39%	200 200	201 199	-0.15% 0.15%	400 400	399 397	0.129 0.369
	METER OUT	50	46	0.39%	200	198	0.30%	400	398	0.475
Meter Box 6 1/13/2010	STACK	100 100	51.5 52.3	6.67% 8.52%	200 200	226.9 227.8	-4.08% -4.21%	425 425	427.1 428	-0.245 -0.349
	FILTER IMPINGER	100 100	62 51.2	8.58% 8.72%	200 200	227.5 226.8	-4.17% -4.05%	425 425	427.5 427	-0.289 -0.239
	METER IN	100	62	8.58%	200	227	-4.08%	425	426	-0.119
Moter Box 7	METER OUT STACK	100 50	52 52	8.58% -0.39%	200 225	226 227	-3.94% -0.29%	425 425	42B 427	-0.119 -0.239
1/13/2010	PROBE FILTER	50 50	52 53	-0.39% -0.59%	225 225	228 228	-0.44% -0.44%	425 425	429 429	-0.45% -0.45%
	IMPINGER	50	52	-0.39%	225	227	-0.20%	425	427	-0.23
	XUX NI RETERI	50 50	52 52	-0.39% -0.39%	225 225	227 226	-0.29% -0.15%	425 425	427 426	-0.239 -0.119
	METER OUT	50	53	₩93.G-	225	224 225	0.15% 0.00%	425 425	427 425	-0.239
1/11/2010	PROBE	50 50	\$0 51	0.00% -0.20%	225 225	226	-0.15%	425	420	-0,119
	FILTER	60 60	52 50	-0.39% 0.00%	225 225	22-5 22-4	-0.16% 0.16%	425 425	426 424	-0.119 0.119
	AUX	50	50	0.00%	225	224	0.15%	425 400	424 403	0.115
	METER IN METER OUT	50 50	52 52	-0,39% -0,39%	200 200	202 203	-0.30% -0.46%	400	403	-0.359 -0.359
Meler Bax 9 1/18/2010	STACK PROBE	100 100	97 97	0.54% 0.54%	200 200	199	0.15% 0.15%	400 400	398 398	0.235
0102010	FILTER	100	97	0.54%	200	100	0.15%	400	397	0.359
	IMPINGER AUX	100 100	97 97	0.54% 0.54%	200 200	189 180	0.15% 0.15%	400 400	397 368	0.36% 0.23%
	METER IN	100 100	100	0,00% -0,18%	200 200	202 202	-0.30% -0.30%	400 400	401 402	-0.12% -0.23%
Meter Box 13	STACK	75	78	-0.56%	200	203	-0.45%	400	404	-0.47%
1/11/2010	PROBE	75 75	. 78 78	-0.50% -0.56%	200 200	202 207	-0.30% -1.05%	400 400	404 402	-0.479 -0.235
	IMPINGER	75	79	-0.75%	200	204	-0.61%	400 400	408 404	-0.70% -0.47%
	AUX METER IN	75 75	80 78	-0.94% -0.56%	200 200	204 203	-0.61% -0.45%	400	404	-0.47%
Meter Box 14	METER OUT STACK	75 100	78 99	-0,56% 0.36%	200	204 198	-0.61% 0.30%	400 400	4 <u>04</u> 394	-0.479 0.709
1/13/2010	PROBE	100	99	0.18%	200	200	0.00%	400	400	0.00%
	FILTER	100 100	97 99	0.54% 0.18%	200 200	197 199	0.45% 0.15%	400 400	395 397	0.47%
	AUX METER IN	100 100	89 89	0.35% 0.56%	200 200	199 198	0,15% 0.30%	400 400	398 397	0.23% 0.35%
	JETER OUT	100	100	4,000	200	201_	-0.15%	400	398	0.23%
Liter Meter 15 2/10/2010	Probe Filter	50 50	51 48	0.20%	200 200	202 200	-0.30% 0.00%	400 400	401 402	-0.12% -0.23%
	Aux-1 Aux-2	50 50	51 49	-0.20% 0.20%	200 200	109 200	0.15% 0.00%	400 400	401 460	-0.12% 0.00%
	METER IN	50	61	-0.20%	200	202	-0.30%	400	404	-0.47%
Liter Moter 16	TUO RETEN	50 50	50_ 51	-0.20%	200	201	-0.15% -0.75%	· 400	403 402	-0.35% -0.23%
2/10/2010	Filter	50	47	D.59%	200	197	0.45%	400 400	397 402	0.35%
	Aux-1 Aux-2	60 60	52 53	-0.59% -0.50%	200 200	202 203	-D.45%	400	402	-0.23%
	METER IN METER OUT	50 50	51 .52	-0.20% -0.39%	200 200	202 201	-0,30% -0,15%	400 400	403 402	-0.36% -0.23%
Liter Meter 17	Proba	50	47	0.50%	200	199	0,15%	400	399	0.12%
2/10/2010	Filter Aux-1	50 50	50 50	%00.0 %00.0	200 200	202 203	-0.30% -0.45%	400 400	399 404	0.12% -0.47%
	Aux-2	50 60	51 52	-0.20% -0.30%	200 200	203 202	-0.45% -0.30%	400 400	402 402	-0.23% -0.23%
	AETER OUT	50 50	52	0.39%	200	202	-0.30%	400	403	-0 35%
Motor Box 19 1/13/2010	PROBE	100 100	98 97	0,38%	200 200	199 198	0.15%	400 400	398 396	0.23% 0.47%
	FILTER	100	97	0.54%	200 200	195	0.30%	400 400	397 390	0.35%
	IMPINGER AUX	100 100	98 98	0.36%	200	199 199	0.15% 0.15%	400	398	0.23%
	METER IN	100 100	97 98	0.54% 0.36%	200 200	198 109	0.30% 0.15%	400 400	397 398	0.35% 0.23%
Malor Box 20	STACK	100	95	0.71%	200	195	0.30%	400	396	0.47%
1/22/2010	PROBE	100 100	29 98	0.71% 0.71%	200 200	195 198	0.30% 0.30%	400 400	396 396	0.47% 0.47%
	BH FILTER IMPINGER	100 100	98	17.67% 0.71%	200 200	198	30.32% 0.30%	409 400	396	48.53% 0.47%
	AUX	100	98	0.71%	200	10B	0.30%	490	396	0.479
Meter Box 21	STACK	100 50	100	0.00%	200	201	-8.15% 0.15%	400 425	400	0.00%
1/14/2010	PROBE	50	46	0.78%	225	224	D.15%	425 426	422 422	0.34% 0.34%
	OVEN BH FILTER	50 50	47	0.59% 0.81%	225 226	224	0.15% 32.80%	425		48.04%
	IMPINGER AUX	50 50	47 47	0.59% 0.59%	225 225	225 224	0.00% 0.15%	425 425	422 423	0.34% 0.23%
	ETER OUT	50	47	0.59%	225	224	0.15%	425	422	0.34%
Fluke 074	1 2			0.00% 0.00%			0.00% 0.00%			%00.0 %00.0
luke 197	.1			0.00%			0.00% 0.00%			0.00% 0.00%
luke 198	1			0.00%			0.00%			0.00%
luke 227	2			0.00%			0.00%			0.00%
	2			0.00%			6,000%			D.00%
luko 22ti	1			0.00%			0.00%			D.00%

Thermocouple Calibrations

		Testers:	PT, PTH, NY,	JMH, PW	Location:	Location: Horizon Shop	
		Ambient		1	Heated		
Meterbox	Standard, F	Measured, F	Difference %	Standard, F		Difference %	
4 In	54.0	55.0	-0.19%	258.0	258.0	0.00%	
1/15/10 Out	54.0	53.0	0.19%	283.0	281.0	0.27%	
5 In	63.1	62.2	0.17%	382.5	382.4	0.01%	
2/3/10 Out	63.6	64.0	-0.08%	220.0	219.0	0.15%	
6 ln	56.0	56.0	0.00%	270.0	272.0	-0.27%	
1/13/10 Out	52.0	53.0	-0.20%	223.0	225.0	-0.29%	
7 In	53.0	54.0	-0.20%	186.0	187.0	-0.15%	
1/13/10 Out	56.0	55.0	0.19%	223.0	223.0	0.00%	
8 in	56.8	57.8	-0.19%	256.1	250.8	0.74%	
1/11/10 Out	58.2	60.1	-0.37%	257.0	261.2	-0.59%	
9 In	56.0	57.0	-0.19%	231.0	232.0	-0.14%	
1/18/10 Out	56.0	55.0	0.19%	263.0	263.0	0.00%	
13 In	61.1	60.5	0.12%	403.1	397.5	0.65%	
1/11/10 Out	55.0	54.3	0.14%	398.5	408.4	-1.15%	
14 !n	53.0	52.0	0.20%	215.0	217.0	-0.30%	
1/13/10 Out	55.0	54.0	0.19%	270.0	271.0	-0.14%	
19 In	57.0	57.0	0.00%	220.0	221.0	-0.15%	
1/13/10 Out	56.0	57.0	-0.19%	206.0	207.0	-0.15%	
20 in	NA	, NA		NA	NA		
1/22/10 Out	55.0	56.0	-0.19%	231.0	230.0	0.14%	
21 In	NA	NA		NA	NA		
1/14/10 Out	61.0	59.0	0.38%	157.0	157.0	0.00%	
		Ambient	_		Heated		
Liter Meter	Standard, F	Measured, F	Difference %			Difference %	
15 In	55.2	56.1	-0.17%	420.2	425.3	-0.58%	
2/10/10 Out	55.2	56.0	-0.16%	429.3	432.3	-0.34%	
16 in	54.6	54.1	0.10%	415.9	406.2	1.11%	
2/10/10 Out	54.6	54.8	-0.04%	420.2	425.6	-0.61%	
17 In	55.1	56.2	-0.21%	405.7	412.3	-0.76%	
2/10/10 Out	55.1	54.8	0.06%	415.6	417.6	-0.23%	

Thermocouple Calibrations

_			Personnel:	JL	Location:	Horizon Shop				
			Ambient			Heated			lce	
	Date	Standard, F		Difference %	Standard, F	Measured, F	Difference %	Standard, F	Measured, F	Difference %
Sample Box - impinger out										
I-01	2/25/2010	56.7	56.5	0.04%	x	X		34.7	34.5	0.04%
1-02	2/24/2010	57.9	58.3	-0.08%	×	x	·	34.5	35.1	-0.12%
1-03	2/24/2010	58.5	59.1	-0.12%	×	x		35.4	35.3	0.02%
1-04	2/24/2010	57.7	58.0	-0.06%	x	x		36.2	36.9	-0.14%
1-05	2/24/2010	58.3	57.9	0.08%	x	x		36.3	36.7	-0.08%
1-06	2/25/2010	56.9	56.5	0.08%	×	x		39.0	38.9	0.02%
1-07	2/24/2010	58.1	57.6	0.10%	x	x		35.5	36.5	-0.20%
I-08	2/24/2010	58.1	57.7	0.08%	×	x		35.1	35.2	-0.02%
1-09	2/24/2010	58.3	57.9	0.08%	×	x		40.2	39.7	0.10%
j-10	2/24/2010	58.4	58.6	-0.04%	x	x		36.9	36.3	0.12%
. i-11	2/24/2010	58.3	57.8	0.10%	x	x		40.1	41.7	-0.32%
j-12	2/24/2010	57.8	57.9	-0.02%	x	x		35.1	35.6	-0.10%
1-13	2/25/2010	56.9	55.8	0.21%	x	x		35.1	35.6	-0.10%
1-14	2/24/2010	58.2	57.9	0.06%	x	x		34.5	35.0	-0.10%
I-15	2/25/2010	57.1	57.5	-0.08%	×	x		35.2	35.0	0.04%
i-16	2/24/2010	58.9	57.9	0.19%	x	x		41.1	41.7	-0.12%
I-17	2/25/2010	57.3	57.5	-0.04%	х	x		42.5	42.4	0.02%
Sample Box - oven										
017	2/12/2010	57.0	56.4	0.12%	198.0	198.0	0.00%	×	x	
018	2/11/2010	53.0	52.4	0.12%	203.8	202.4	0.21%	x	×	
019	2/15/2010	53.2	53.2	0.00%	206.8	206.2	0.09%	x	x	
020	2/12/2010	55.6	55. 6	0.00%	204.6	205.6	-0.15%	x	×	
156	2/12/2010	52.6	53.0	-0.08%	199.2	200.6	-0.21%	x	x	
172	2/15/2010	53.2	53.0	0.04%	199.2	200.4	-0.18%	×	x	
173	2/11/2010	55.2	54.4	0.16%	199.6	199.8	-0.03%	x	x	
184	2/15/2010	53.8	53.4	0.08%	198.8	200.4	-0.24%	х	x	
185	2/12/2010	55.4	55.0	0.08%	208.4	207.2	0.18%	x	x	
186	2/11/2010	52.4	52.0	0.08%	200.0	200.0	0.00%	x	x	
187	2/12/2010	57.0	58.6	0.08%	207.2	207.0	0.03%	x	x	
188	2/11/2010	61.2	61.0	0.04%	204.2	206.0	-0.27%	x	×	
189	2/10/2010	54.2	53.2	0.19%	200.0	198.4	0.24%	x	x	
190	2/24/2010	56.1	55.9	0.04%	219.5	219.3	0.03%	x	×	
229	2/24/2010	56.1	55.9	0.04%	354.0	353.7	0.04%	×	x	
230	2/24/2010	56.1	56.0	0.02%	255.8	255.5	0.04%	x	x	
327	2/12/2010	56.2	55.B	0.08%	206.8	205.0	0.12%	×	x	
328	2/12/2010	55.4	64.6	0.16%	201.2	200.0	0.18%	x	x	
329	2/12/2010	55.4	54.6	0.16%	200.0	200.0	0.00%	x	x	
331	2/10/2010	54.8	54.0	0.16%	206.2	208.0	-0.27%	×	×	
331	2/10/2010	0.40	34.0	0.1070	200.2	200.0	-0.21 //	<u> </u>		

4233 N. E. 147TH AVENUE



CERTIFICATE

Certified By:

Edgel Company.

		ABO	R		•
FOR	E Lan	F -0	7		
Type K The	rmocouple	,)	
1/4" x 36"	wApluq			70	
SeriaL# 20	0781, 277	GIANT IDG	ATOTATOLY		
Submitted	By DATE			S	
Horizon End	inceriaci.			1	
13585 NE W	nittäken W	ay	Q		
Portland,	OR 97230	~~	90.		
<u>T/C #</u> 200701 200702 200703	32°F +.9 +.3 +.5	212°F -1.3 -1.0 9	handing Berth		

The accuracy stated on this certificate is traceable to the NATIONAL BUREAU OF STAND-ARDS through certification documents on file in the Metrology Laboratory of the Grant

Resubmission Date:

Fluke Model 724 Serial# 9806098

11-18-09

Test Con	ditions	Authorized Signatures
AMBIENT TEMP.:	68°F	DEPENDENT DE DE
REL. HUMIDITY:	45%	PERFORMED BY: NO
DATE:	6-4-09	
report no.:	09F-4 .	APPROVED BY: Bil Edgel
SERVICE ORDER:	20507	APPROVED BY: // AUD CO-36-
P.O. NUMBER:		RESUBMISSION DATE: 6-4-10

CLEPHONE 254-6524 (AREA DODE 505)

4 233 N. E. 147TH AVENUE A P. O. BOX 20116

PORTLAND, DREGON 97220



CERTIFICATE

		, ABC) R a	
FOR		*		
Altek Ca	librator)
Series 2	2 7		TO ALEMAN	P
Serial#	10400304	PRIMARY STANDAR	DIGEL DE LABORATORY MONTON	
	STATE OF STA	ID NO		
Submitte	д Ву	D ATE		<i>Υ</i>
Horizon 1	Engineeri	e Gije		
13585 NE	Whittake	r Nay	Q.	
Portland	OR 972	30 / ~	10	
Test 0°F 50°F 100°F 150°F 200°F	Error +.5 5 6 5	Test 300°F 350°F 400°F 450°F 500°F	Error 5 5 6 6	Certified By: Fluke Model 724 Serial# 9806098 Resubmission Date; 11-18-09

The accuracy stated on this certificate is traceable to the NATIONAL BUREAU OF STAND-ARDS through certification documents on file in the Metrology Laboratory of the Grant Edgel Company.

Test Con	ditions	Authorized Signatures
AMBIENT TEMP.:	68°F	PERFORMED BY: RG-
REL. HUMIDITY:	<u>45</u> ዬ	PERFORMED BI: // V. U
DATE:	6-4-09	
report no. :	09F-1 .	APPROVED BY: Bob Edgel
SERVICE ORDER:	20507	APPROVED BY: 1000 COSC
P.O. NUMBER:	·	RESUBMISSION DATE: 6-4-10

MFG. RED COMET OVEN

254-6524 (ARCA CDOC BOD)



4233 N. E. 147TH AVENUE

P. D. BOX 20116

PORTLAND, DREGON 97220

CERTIFICATE

	, ABORA,	
FOR	14	
Type K Thermocoup	ple	<u> </u>
1/8" x 3" w/gjug	Control of the Asia	P
Serial# 200602	GRANT EDGEL PRIMARY STANDARDS LABORATORY	manufacture
Submitted By	ID: NO: DATE	US
Horizon Engimeer	NEX I	_
13585 NE Whittake	(DESCRIPTION OF THE PROPERTY O	£
	7230 STANDP	
<u>Test</u> <u>Error</u> 32°F8 212°F6	· James	
Cortified Dr. F	Tluke Model 724 Comin	3 # 0006000

The accuracy stated on this certificate is traceable to the NATIONAL BUREAU OF STAND-ARDS through certification documents on file in the Metrology Laboratory of the Grant Edgel Company.

Resubmission Date: 11-18-09

Test Con	ditions	Authorized Signatures
AMBIENT TEMP. :	_68°F	DEPENDENT DE DE
REL. HUMIDITY:	45%	PERFORMED BY: // (/
DATE:	6-4-09	
report no. :	09F-3	ARROWED BY Bob Edgel
SERVICE ORDER:	20507	APPROVED BY: 1200 COGO.
P.O. NUMBER:		RESUBMISSION DATE: 6-4-10
		I .

ELEPHONE 254-6524 (AIICA CODC 500)

4233 N. E. 147TH AVENUE

P. C. BOX 20116

PORTLAND, OREGON 97220



CERTIFICATE

FOF	₹			ik d	ži _ę	
A.	ltek Cal:	ibrator		•	0	
Se	eries 22	Control of the same			73	
S	erial# 1(0663701	PEHANY STANDA	EDGEL ROS LABORATORY AUGAIDS	200 Per 18	
			ID. NO			
Sub	mitted		DATE		S	
Н	orizon Er	ıgineeri	NEW		A STATE OF THE PARTY OF THE PAR	
1:	3585 NE V	Whittake	Way	<	Q	
Pc	ortland,	OR 97	230 -	NOP	*	
] 1 (1 !	est 0°F 50°F 50°F 50°F	Error + . 8 + . 7 + . 7 + . 7 + . 9	Test 300°F 350°F 400°F 450°F 500°F	Error +.8 +.9 +.8] 2 1	Pertified By: Fluke Model 724 Serial# 9806098 Resubmission Date: 11-18-09

The accuracy stated on this certificate is traceable to the NATIONAL BUREAU OF STANDARDS through certification documents on file in the Metrology Laboratory of the Grant Edgel Company.

Test Con	ditions	Authorized Signatures
AMBIENT TEMP.:	68°F	-
REL. HUMIDITY:	45%	PERFORMED BY:
DATE:	6-4-09	_
REPORT NO.:	09F-2	Block
SERVICE ORDER:	20507	APPROVED BY: Bob Edgel
P.O. NUMBER:		RESUBMISSION DATE: 6-4-10
		- 1

Nozzle Calibrations

	Nozzle ID	ħ/ĭ	easuremen	ite	Averages	Date
Quartz	HOLLIG ID	111	casaremen.		Avelages	Date
Quartz	Q1	0.3170	0.3160	0.3165	0.3165	2/3/2010
	Q2	0.2625	0.2630	0.2620	0.2625	5/1/2009
	Q2 Q3	0.2515	0.2525	0.2530	0.2523	5/1/2009
	, Q3	0.2650	0.2645	0.2650	0.2648	3/11/2010
	Q5	0.2645	0.2645	0.2640	0.2643	7/14/2009
	Q6	0.3450	0.3463	0.3455	0.3456	2/2/2010
	Q7	0.3715	0.3715	0.3705	0.3450	10/28/2009
	Q8	0.2574	0.2560	0.2565	0.2566	7/10/2009
	Q 9	0.2374	0.2300	0.2565	0.3698	
						2/2/2010
	Q10 Q11	0.3695	0.3705	0.3700	0.3700	8/5/2009
		0.3735	0.3745	0.3750	0.3743	10/28/2009
	Q12	0.3665	0.3665	0.3655	0.3662	2/2/2010
	Q13	0.3665	0.3665	0.3675	0.3668	2/3/2010
	Nozzle iD	M	easuremen	ts	Averages	Date
Pyrex					_	
	1	0.3115	0.3115	0.3105	0.3112	10/28/2009
	2	0.3180	0.3165	0.3175	0.3173	9/23/2009
	3	0.2595	0.2610	0.2605	0.2603	7/10/2009
	4	0.2605	0.2615	0.2610	0.2610	7/10/2009
	5	0.2605 0.2625	0.2615 0.2630	0.2610 0.2630		
	5 6				0.2610	7/10/2009
-	5 6 7	0.2625 0.2645 0.2640	0.2630 0.2650 0.2635	0.2630	0.2610 0.2628 0.2645 0.2640	7/10/2009 8/3/2009
-	5 6	0.2625 0.2645	0.2630 0.2650	0.2630 0.2640	0.2610 0.2628 0.2645 0.2640 0.2648	7/10/2009 8/3/2009 8/3/2009
	5 6 7	0.2625 0.2645 0.2640	0.2630 0.2650 0.2635	0.2630 0.2640 0.2645	0.2610 0.2628 0.2645 0.2640	7/10/2009 8/3/2009 8/3/2009 8/3/2009
	5 6 7 8	0.2625 0.2645 0.2640 0.2645	0.2630 0.2650 0.2635 0.2650	0.2630 0.2640 0.2645 0.2650	0.2610 0.2628 0.2645 0.2640 0.2648	7/10/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009
	5 6 7 8 9	0.2625 0.2645 0.2640 0.2645 0.2570	0.2630 0.2650 0.2635 0.2650 0.2580	0.2630 0.2640 0.2645 0.2650 0.2580	0.2610 0.2628 0.2645 0.2640 0.2648 0.2576	7/10/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009
	5 6 7 8 9	0.2625 0.2645 0.2640 0.2645 0.2570 0.3135	0.2630 0.2650 0.2635 0.2650 0.2580 0.3140	0.2630 0.2640 0.2645 0.2650 0.2580 0.3140	0.2610 0.2628 0.2645 0.2640 0.2648 0.2576 0.3138	7/10/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 10/28/2009
	5 6 7 8 9 10	0.2625 0.2645 0.2640 0.2645 0.2570 0.3135 0.3100	0.2630 0.2650 0.2635 0.2650 0.2580 0.3140 0.3105	0.2630 0.2640 0.2645 0.2650 0.2580 0.3140 0.3110	0.2610 0.2628 0.2645 0.2640 0.2648 0.2576 0.3138 0.3105	7/10/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 10/28/2009 8/3/2009
	5 6 7 8 9 10 11	0.2625 0.2645 0.2640 0.2645 0.2570 0.3135 0.3100 0.3175	0.2630 0.2650 0.2635 0.2650 0.2580 0.3140 0.3105 0.3130	0.2630 0.2640 0.2645 0.2650 0.2580 0.3140 0.3110 0.3135	0.2610 0.2628 0.2645 0.2640 0.2648 0.2576 0.3138 0.3105 0.3147	7/10/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 10/28/2009 5/1/2009
	5 6 7 8 9 10 11 12	0.2625 0.2645 0.2640 0.2645 0.2570 0.3135 0.3100 0.3175	0.2630 0.2650 0.2635 0.2650 0.2580 0.3140 0.3105 0.3130	0.2630 0.2640 0.2645 0.2650 0.2580 0.3140 0.3110 0.3135 0.3190	0.2610 0.2628 0.2645 0.2640 0.2648 0.2576 0.3138 0.3105 0.3147 0.3183	7/10/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 10/28/2009 5/1/2009 8/3/2009
	5 6 7 8 9 10 11 12 13	0.2625 0.2645 0.2640 0.2645 0.2570 0.3135 0.3100 0.3175 0.3175	0.2630 0.2650 0.2655 0.2650 0.2580 0.3140 0.3105 0.3130 0.3185 0.3085	0.2630 0.2640 0.2645 0.2650 0.2580 0.3140 0.3110 0.3135 0.3190 0.3085	0.2610 0.2628 0.2645 0.2640 0.2648 0.2576 0.3138 0.3105 0.3147 0.3183 0.3080	7/10/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 10/28/2009 8/3/2009 5/1/2009 5/1/2009
	5 6 7 8 9 10 11 12 13 14	0.2625 0.2645 0.2640 0.2645 0.2570 0.3135 0.3100 0.3175 0.3175 0.3070 0.3130	0.2630 0.2650 0.2655 0.2650 0.2580 0.3140 0.3105 0.3130 0.3185 0.3085 0.3110	0.2630 0.2640 0.2645 0.2650 0.2580 0.3140 0.3110 0.3135 0.3190 0.3085 0.3120	0.2610 0.2628 0.2645 0.2640 0.2648 0.2576 0.3138 0.3105 0.3147 0.3183 0.3080 0.3120	7/10/2009 8/3/2009 8/3/2009 8/3/2009 8/3/2009 10/28/2009 5/1/2009 5/1/2009 5/1/2009 5/1/2009



13585 NE Whitaker Way • Portland, OR 97230 Phone (503) 255-5050 • Fax (503) 255-0505 www.horizonengineering.com

January 12, 2010 Horizon Engineering Shop Barometer Calibration

National Weather Service (PDX Int'l Airport)	29.82"Hg
TV 1 /	30.0"Hg
TV 2 V	29.8"Hg
TV 3	29.8"Hg
TV 4	30.0"Hg
Shop	30.1"Hg
Shortridge #1	30.1"Hg
Shortridge #2	30.0"Hg
Shortridge #3	29.8"Hg
Paul Heffernan's personnel wrist barometer	29.8"Hg

All pressures are absolute, read at the Horizon Engineering shop. Margery P. Heffernan



6531 BOX SPRINGS BLVD. • RIVERSIDE, CA 92507 TELEPHONE (951) 653-6780 PAX (951) 653-2430

0-10

Report Of Analysis EPA Protocol Gas Mixtures

HENG01

TO: Horizon Engineering/Infrared NW Attn: David Bagwell 13585 NE Whitaker Way Portland, OR 97230

REPORT NO: 56420-01

REPORT DATE: October 20, 2009(:

CUSTOMER PO NO: 1013

CYLINDER NUMBER: CC83874

(503) 255-5050

CYLINDER SIZE: 150A /141 std cu fil

CYLINDER PRESSURE: 2000 psig

OTEMPEN NUMBER, DOGGOTA		OTEMPER ORDER 1307 (141 310 60 10)		OTEMBER PRESSURE: 2000 paig	
COMPONENT	CONCENTRATION (v/v) ± EPA UNCERTAINTY	REFERENCE STANDARD	ANALYZER MAKE, MODEL, S/N, DETECTION	EXPIRATION DATE	REPLICATE ANALYSIS DATA
Oxygen	11.50 ± 0.06 %	GMIS CYLINDER #: CC81204 @ 9.89 %	Varian Model 3800 Serial # Thermal Conductivity Gas Chromotography LAST CAL DATE: 10/12/200	10/19/2012 9 MEAN:	10/19/2009 11.47 % 11.51 % 11.51 % 11.50 %
Nitrogen	Balance				

ppm = umole/mole

% = mole-%

The above analyses were performed in accordance with Procedure G1 of the EPA Traceability Protocol, Report Number EPA-600/R97/121, dated September 1997.

The above analyses are invalid if the cylinder pressure is less than 150 psig.

M.S.Calhoun

ANALYST:



6531 BOX SPRINGS BLVD. . RIVERSIDE, CA 92507 TELEPHONE (951) 653-6780 • FAX (951) 653-2430

Report Of Analysis **EPA Protocol Gas Mixtures**

HENG01

TO: Horizon Engineering/Infrared NW

Attn: David Bagwell 13585 NE Whitaker Way Portland, OR 97230 (503) 255-5050

REPORT NO: 54924-01

REPORT DATE: December 31, 20080

CUSTOMER PO NO: 005363

CYLINDER NUMBER: CA07129

CYLINDER SIZE: 150A (92 std cu ft)

CVI INDED DEESSURE: 1300 neig

CIEMPER MUNICER. ONG! 120		OT LINDEN GIZE, TOOM (SZ SIG CO II)		CTLINDER PRESSURE. 1000 pag	
COMPONENT	CONCENTRATION (v/v) ± EPA UNCERTAINTY	REFERENCE STANDARD	ANALYZER MAKE, MODEL, S/N, DETECTION	EXPIRATION DATE	REPLICATE ANALYSIS DATA
Oxygen	22.26 ± 0.23 %	GMIS CYLINDER #: ALM031591 @ 24.39 %	Varian Model 3800 Serial # Thermal Conductivity Gas Chromotography LAST CAL DATE: 12/24/200	12/26/2011 B MEAN:	12/26/2008 22.25 % 22.25 % 22.27 % 22.26 %
Nitrogen	Balance				

ppm = umole/mole

% = mole-%

The above analyses were performed in accordance with Procedure G1 of the EPA Traceability Protocol, Report Number EPA-600/R97/121, dated September 1997.

The above analyses are invalid if the cylinder pressure is less than 150 psig.

ANALYST:

M.S.Calhoun

64



6531 BOX SPRINGS BLVD. • RIVERSIDE, CA 92507 TELEPHONE (951) 653-6780 • FAX (951) 653-2430

01-12-10

Report Of Analysis EPA Protocol Gas Mixtures

HENG01

TO: Horizon Engineering/Infrared NW

Attn: David Bagwell 13585 NE Whitaker Way Portland, OR 97230 (503) 255-5050 REPORT NO: 56855-01

REPORT DATE: January 6, 2010□

CUSTOMER PO NO: 1059

CYLINDER NUMBER: CC99500		CYLINDER SIZE: 150A (141 std cu ft)		CYLINDER PRESSURE: 2000 psig		
COMPONENT	CONCENTRATION (v/v ± EPA UNCERTAINTY		ANALYZER MAKE, MODEL, SIN, DETECTION	EXPIRATION DATE	REPLICATE ANALYSIS DATA	
Carbon dioxide	6.01 ± 0.06 %	GMIS CYLINDER #: CC83094 @ 8.08 %	Varian Model 3400 Serial # 10680 Thermal Conductivity Gas Chromotography LAST CAL DATE: 11/9/2009	12/8/2011 MEAN:	12/8/2009 6.01 % 6.02 % 6.01 % 6.01 %	
Carbon monoxide	279.1 ± 1.2 ppm	GMIS CYLINDER #: 1L3309 @ 283.2 ppmv	Carle Insts Model 8000 Serial # 8249 Methanation/FID Gas Chromatography LAST CAL DATE: 12/15/200	12/18/2011 9 MEAN:	12/10/2009 12/18/2009 279.2 ppm 279.0 ppm 278.8 ppm 279.0 ppm 279.0 ppm 279.3 ppm 279.0 ppm 279.1 ppm	
Nitric oxide NOx Nitrogen dioxide	48.8 ± 0.3 ppm 48.8 ppm < 0.2 ppm	GMIS CYLINDER #: CC28420 @ 50.6 ppmv	Bovar/W Res Model 922M Serial # VD92284841 Continuous UV Photometry LAST CAL DATE: 12/24/2009	12/24/2011 MEAN:	12/8/2009 12/24/2009 48.8 ppm 48.8 ppm 48.6 ppm 48.8 ppm 48.7 ppm 48.7 ppm 48.7 ppm 48.8 ppm	

ppm ≈ umole/mole

O2-free Nltrogen

% = mole-%

The above analyses were performed in accordance with Procedure G1 of the EPA Traceability Protocol, Report Number EPA-600/R97/121, dated September 1997.

The above analyses are invalid if the cylinder pressure is less than 150 psig.

Balance

ANALYST:

D.C.Marrin

APPROVED:

J. T. Marrin



6531 BOX SPRINGS BLVD. • RIVERSIDE, CA 92507 TELEPHONE (951) 653-6780 • FAX (951) 653-2430



01-12-10

Report Of Analysis EPA Protocol Gas Mixtures

HENG01

TO: Horizon Engineering/Infrared NW

Attn: David Bagwell 13585 NE Whitaker Way Portland, OR 97230 (503) 255-5050 REPORT NO: 56855-02

REPORT DATE: January 6, 2010

CUSTOMER PO NO: 1059

CYLINDER NUMBER: CC1859		CYLINDER SIZE: 150A (141 std cu ft)		CYLINDER PRESSURE: 2000 psig		
COMPONENT	CONCENTRATION (v/v ± EPA UNCERTAINTY) REFERENCE STANDARD	ANALYZER MAKE, MODEL, SIN, DETECTION	EXPIRATION DATE	REPLICATE ANALYSIS DATA	
Carbon dioxide	12.38 ± 0.05 %	GMIS CYLINDER #: CC51172 @ 18.01 %	Varian Model 3400 Serial # 10680 Thermal Conductivity Gas Chromotography LAST CAL DATE: 11/9/2009	12/8/2011 MEAN:	12/8/2009 12.35 % 12.38 % 12.40 % 12.38 %	
Carbon monoxide	465 ± 4 ppm	GMIS CYLINDER #: ALM021481 @ 548 ppmv	Carle Insts Model 8000 Serial # 8249 Methanation/FID Gas Chromatography LAST CAL DATE: 12/15/2009	12/18/2011 MEAN:	12/10/2009 12/18/2009 465 ppm 465 ppm 464 ppm 465 ppm 464 ppm 465 ppm 464 ppm 465 ppm	
Nitric oxide NOx Nitrogen dioxide	89.0 ± 0.7 ppm 89.0 ppm < 0.4 ppm	GMIS CYLINDER #: CC101293 @ 100.1 ppmv	Bovar/W Res Model 922M Serial # VD92284841 Continuous UV Photometry LAST CAL DATE: 12/24/2009	1/5/2012 MEAN:	12/24/2009 1/5/2010 89.1 ppm 88.8 ppm 89.2 ppm 89.0 ppm 89.3 ppm 89.2 ppm 89.2 ppm 89.0 ppm	

ppm = umole/mole

O2-free Nitrogen

% = mole-%

Balance

The above analyses were performed in accordance with Procedure G1 of the EPA Traceability Protocol, Report Number EPA-600/R97/121, dated September 1997.

The above analyses are invalid if the cylinder pressure is less than 150 psig.

ANAI VST.

D C Marrin

APPROVED

J. T. Marrir

66

QA/QC Documentation

Procedures
Analyzer Interference Response Data

Introduction The QA procedures outlined in the U. S. Environmental Protection Agency (EPA) test methods are followed, including procedures, equipment specifications, calibrations, sample extraction and handling, calculations, and performance tolerances. Many of the checks performed have been cited in the Sampling section of the report text. The results of those checks are on the applicable field data sheets in the Appendix.

Continuous Analyzer Methods Field crews operate the continuous analyzers according to the test method requirements, and Horizon's additional specifications. On site quality control procedures include:

- Analyzer calibration error before initial run and after a failed system bias or drift test (within ± 2.0% of the calibration span of the analyzer for the low, mid, and high-level gases or 0.5 ppmv absolute difference)
- System bias at low-scale (zero) and upscale calibration gases (within ± 5.0% of the calibration span or 0.5 ppmv absolute difference)
- Drift check (within ±3.0% of calibration span for low, and mid or highlevel gases, or 0.5 ppmv absolute difference)
- System response time (during initial sampling system bias test)
- · Checks performed with EPA Protocol 1 or NIST traceable gases
- Leak free sampling system
- Data acquisition systems record 10-second data points or one-minute averages of one second readings
- NO₂ to NO conversion efficiency (before each test)
- Purge time (= 2 times system response time and will be done before starting run 1, whenever the gas probe is removed and re-inserted into the stack, and after bias checks)
- Sample time (at least two times the system response time at each sample point)
- Sample flow rate (within approximately 10% of the flow rate established during system response time check)
- Interference checks for analyzers used will be included in the final test report
- Average concentration (run average = calibration span for each run)
- Stratification test (to be done during run 1 at three(3) or twelve(12)
 points according to EPA Method 7E; Method 3A, if done for molecular
 weight only, will be sampled near the centroid of the exhaust;
 stratification is check not normally applicable for RATAs)

Manual Equipment QC Procedures On site quality control procedures include pre- and post-test leak checks on trains and pitot systems. If pre-test checks indicate problems, the system is fixed and rechecked before starting testing. If post-test leak checks are not acceptable, the test run is voided and the run is repeated. Thermocouples and readouts are verified in the field to read ambient prior to the start of any heating or cooling devices. Nozzles are checked for nicks or dents and are measured on three diameters twice each year.

Sample Handling Samples taken during testing are handled to prevent contamination from other runs and ambient conditions. Sample containers are glass, Teflon™, or polystyrene (filter petri dishes) and are pre-cleaned by the laboratory and in the Horizon Engineering shop. Sample levels are marked on containers and are verified by the laboratory. All particulate sample containers are kept upright and are delivered to the laboratory by Horizon personnel.

Data Processing Personnel performing data processing double-check that data entry and calculations are correct. Results include corrections for field blanks and analyzer drift. Any abnormal values are verified with testing personnel and the laboratory, if necessary.

After results are obtained, the data processing supervisor validates the data with the following actions:

- verify data entry
- check for variability within replicate runs
- account for variability that is not within performance goals (check the method, testing, and operation of the plant)
- · verify field quality checks

Equipment Calibrations Periodic calibrations are performed on each piece of measurement equipment according to manufacturers' specifications and applicable test method requirements. The Oregon Department of Environmental Quality (ODEQ) Source Testing Calibration Requirements sheet is used as a guideline. Calibrations are performed using primary standard references and calibration curves where applicable.

Thermocouples Thermocouples are calibration checked against an NIST traceable thermocouple and indicator system every six months at three points. Thermocouple indicators and temperature controllers are checked using a NIST traceable signal generator. Readouts are checked over their usable range and are adjusted if necessary (which is very unusual).

Pitots Every six months, S-type pitots are calibrated in a wind tunnel at three points against a standard pitot using inclined manometers. They are examined for dents and distortion to the alignment, angles, lengths, and proximity to thermocouples before each test. Pitots are protected with covers during storage and handling until they are ready to be inserted in the sample ports.

Dry Gas Meters Dry gas meters used in the manual sampling trains are calibrated at three rates using a standard dry gas meter that is never taken into the field. The standard meter is calibration verified by the Northwest Natural Gas meter shop once every year. Dry gas meters are post-test calibrated with documentation provided in test reports.



13585 NE Whitaker Way • Portland, OR 97230 Phone (503) 255-5050 • Fax (503) 255-0505 www.horizonengineering.com

INTERFERENCE RESPONSE TEST

Date of Test: 1/24/02

Name: <u>Mike Eisele</u>

Analyzer: Type / Model: O2 / Servomex 1400 Serial Number: 000012

Test Gas	Concentration,	Analyzer Output Response, %	% of Span (25 %)
SO ₂	170.3 ppmv	0.0	0.0
*CO ₂	10.5%	0.0	0.0
**CO	510.6 ppmv	0.0	0.0

^{*}Used bottle of CO₂ at 100% concentration and diluted it with 100% N2 to get a concentration of about 10% CO₂.

Bias Check:

Test Gas	Concentration, %	Analyzer Output Response, %	Bias Check (%)
O_2	20.95	20.8	0.6

Performance Specifications:

		<u>Allowable</u>	
<u>Analyzer</u>	EPA Ref.	<u>Interference</u>	Gas Values To Introduce Into Analyzers
	Method	(% of analyzer span)	(EPA Method 20)
SO ₂	6C	7%	200±20 ppm
O_2	6C	7%	20.9±1 percent
CO ₂	6C	7%	10±1 percent
CO	20	2%	500±50 ppm

Note: Concentration for SO₂ was slightly lower than listed; 170.3 ppmv was the closest concentration cylinder available at the time of the interference checks.

^{**}Used CO mix cylinder with 2553 ppmv CO and diluted it with 100% N2 to get a concentration of about 500 ppmv.



13585 NE Whitaker Way • Portland, OR 97230 Phone (503) 255-5050 • Fax (503) 255-0505 www.horizonengineering.com

INTERFERENCE RESPONSE TEST

Date of Test: 1/24/02

Name: Mike Eisele

Analyzer: Type / Model: CO₂ / Servomex 1400 Serial Number: 000050

Results:

	Concentration,		% of Span
Test Gas	ppmv or %	Analyzer Output Response, %	(25 %)
SO ₂	170.3 ppmv	0.0	0.0
O ₂	20.95 %	0.0	0.0
**CO ₂	10.5	10.5	0.0
*CO	510.6 ppmv	0.0	0.0

^{*}Used CO mix cylinder with 2553 ppmv CO and diluted it with 100% N_2 to get a concentration of about 500 ppmv CO.

Bias Check:

Test Gas	Concentration, %	Analyzer Output Response, %	Bias Check (%)
**CO ₂	10.5	10.5	0.0

^{**} Used bottle of CO_2 at 100% concentration and diluted it with 100% N_2 to get a concentration of about 10% CO_2 .

Performance Specifications:

		<u>Allowable</u>	
<u>Analyzer</u>	EPA Ref.	<u>Interference</u>	Gas Values To Introduce Into Analyzers
	<u>Method</u>	(% of analyzer span)	(EPA Method 20)
SO ₂	6C	7%	200±20 ppm
O_2	6C	7%	20.9±1 percent
CO ₂	6C	7%	10±1 percent
CO	20	2%	500±50 ppm

Note: Concentration for SO₂ was slightly lower than listed; 170.3 ppmv was the closest concentration cylinder available at the time of the interference checks.

Correspondence
Source Test Plan and Correspondence
Permit (Selected Pages)

e-maile/ 3/2/10



13585 NE Whitaker Way • Portland, OR 97230 Phone (503) 255-5050 • Fax (503) 255-0505 www.horizonengineering.com

March 2, 2010

Project No. 3472

Mr. Gerry Pade Puget Sound Clean Air Agency 1904 3rd Ave, Suite 105 Seattle, Washington 98101-3317

Ms. Madonna Narvaez Environmental Engineer USEPA Region 10, AWT-107 1200 Sixth Avenue Seattle, Washington 98101

Re: Source Testing:

Saint-Gobain Containers 5801 East Marginal Way S. Seattle, Washington 98134

This correspondence is notice that Horizon Engineering is to do source testing for the above-referenced facility, scheduled for March 11, 2010. This will serve as the Source Test Plan unless changes are requested prior to the start of testing.

- Source to be Tested: Glass Melting Furnace No. 5 (Inlet to the Cloud Chamber)
- 2. **Purpose of the Testing:** To demonstrate compliance with the National Emission Standard for Hazardous Air Pollutants for Glass Manufacturing Area Sources, 40 CFR Part 63, Subpart SSSSS for affected sources.
- 3. Source Description: There are four glass-melting furnaces at the site. Furnaces No. 5 is oxy-fuel fired, with oxygen gas being used to support combustion rather than ambient air. This process results in greater overall energy efficiency, improved energy transfer to the glass, and a significant reduction in NO_x emissions. The primary fuel source of Furnace No. 5 is natural gas with additional energy input from electricity delivered through electrodes immersed in the glass (electric boosting).
- 4. Pollutant to be Tested: Chrome

5. **Test Methods to be Used:** Testing will be conducted in accordance with EPA Methods in <u>Title 40 Code of Federal Regulations Part 60 (40 CFR 60)</u>, Appendix A, July 1, 2007.

Flow Rate: EPA Methods 1 and 2 (S-type pitot w/ EPA Method 29

raverses)

CO₂ and O₂: EPA Method 3/3A (integrated bag samples with NDIR and

paramagnetic analyzers)

Moisture: EPA Method 4 (incorporated with EPA Method 29)

Chrome: EPA Method 29 (isokinetic impinger technique with analysis

by ICP-OES/ICP-MS)

6. **Integrated Bag Gas Sampling:** EPA Method 3/3A will be sampled simultaneously and traversed with EPA Method 29 sampling probe. Tedlar bags will be filled off the exhaust of the sampling train.

 Quality Assurance /Quality Control (QA/QC): Documentation of the procedures and results will be presented in the source test report for review. This documentation will include at least the following:

Continuous analyzer QC procedures for Tedlar bags: Field crews will operate the analyzers according to the test method requirements and Horizon's additional specifications. On-site quality control procedures include:

- Daily calibration (zero and span) and calibration error (linearity) checks
- Tedlar bags will be analyzed after daily calibration and calibration error checks
- Checks performed with EPA Protocol 1gases
- Data acquisition systems record one-minute averages of one second readings

Manual equipment QC procedures: Operators will perform pre- and post-test leak checks on the sampling system and pitot lines. Thermocouples attached to the pitots and probes are calibrated in the field using EPA Alternate Method 11. A single-point calibration on each thermocouple system using a reference thermometer is performed. Thermocouples must agree within ±2°F with the reference thermometer. Also, prior to use, thermocouple systems are checked for ambient temperature before heaters are started. Nozzles are inspected for nicks or dents and pitots are examined before and after each use to confirm that they are still aligned. Pre- and post-test calibrations on the meter boxes will be included with the report, along with semi-annual calibrations of critical orifices, pitots, nozzles and thermocouples (sample box impinger outlet and oven, meter box inlet and outlet, and thermocouple indicators). Blank reagents are submitted to the laboratory with the samples. Liquid levels are marked on sample jars in the field and are verified by the laboratory.

- 8. Number of Sampling Replicates and their Duration: Three (3) test runs of at least 120 minutes each.
- 9. Reporting Units for Results: Results will be expressed as concentrations (ppmv or gr/dscf), as rates (lb/hr), and on a production basis (lb/ton).

10. Emission Limit:

Subpart SSSSS Limit: 0.02 lb/ton

11. Horizon Engrg. Contacts: David Bagwell or

Preston Škaggs (503) 255-5050

(503) 255-0505 Fax

E-mail dbagwell@horizonengineering.com pskaggs@horizonengineering.com

12. Parent Company Contact: Jayne Browning

(765) 741-7112 (765) 741-4846 Mobile Fax (765) 741-4846

jayné.e.browning@saint-gobain.com E-mail

13. Source Site Personnel: Marlon Trigg

(206) 768-6221 (206) 730-1888

Mobile Fax (206) 768-6266

E-mail Marlon.Trigg@saint-gobain.com

14. Regulatory Contacts: Gerry Pade

(206) 689-4065

Fax (206) 343-7522

E-mail gerryp@pscleanair.org

facilitysubmittal@pscleanair.org

Madonna Narvaez (206) 553-2117

Fax (206) 553-0110

E-mail narvaez.madonna@epa.gov

- 15. Applicable Process/Production/Control Information: Operating data that characterize the source are considered to be:
 - Fuel usage during each run
 - Amount of glass melted
 - All other normally recorded process information

Process/Production/Control information is to be gathered by the Source Site Personnel and provided to Horizon for inclusion in the report.

The source must operate at a normal maximum rate during testing.

16. Other Considerations:

It is requested that the sixty day test plan notification be waived because of the variability of the production schedule and the short time in which the green glass will be produced.

 Each furnace exhaust has been checked for cyclonic flow during past testing and no cyclonic conditions exist at any exhaust. Cyclonic flow checks were done on September 22, 2005 and February 25, 2009 and are documented in those test reports.

17. Administrative: Unless notified prior to the start of testing, this test plan is considered to be approved for compliance testing of this source. A letter acknowledging receipt of this plan and agreement on the content (or changes as necessary) would be appreciated.

The Agency will be notified of any changes in source test plans prior to testing. It is recognized that significant changes not acknowledged, which could affect accuracy and reliability of the results, could result in test report rejection.

Source test reports will be prepared by Horizon Engineering and will include all results and example calculations, field sampling and data reduction procedures. laboratory analysis reports, and QA/QC documentation. Source test reports will be submitted to you within 60 days of the completion of the field work, unless another deadline is agreed upon. Saint-Gobain Containers should send one (1) hardcopy and one (1) electronic copy of the completed source test report to you at the address above.

Any questions or comments relating to this test plan should be directed to me.

Sincerely,

David Bagwell, QSTI Managing Member

Sil Aguel

Horizon Engineering

Jayne Browning, Saint-Gobain Containers, Inc. cc: Marlon Trigg, Saint-Gobain Containers, Inc. Valerie Krulic, Saint-Gobain Containers, Inc.



PUGET SOUND CLEAN AIR AGENCY

1904 3rd Ave Ste 105 Seattle WA 98101-3317

Telephone: (206)689-4052; Fax: (206)343-7522 <www.pscleanair.org>

facilitysubmittal@pscleanair.org

COMPLIANCE TEST NOTIFICATION

This Notification of intended action does not constitute approval by the Agency nor does it satisfy a requirement for a test plan, if one exists.

Agency Use Only: Reg No:	Date Receive	ed:	433	Date Logged:	
Facility Name: Saint-Gobain Containers				tact Information for Test	
		N	ame: Marlo	on Trigg	
Facility Address (include city/state/zip):		PI	none: 206-	730-1888	
5801 East Marginal Way South		Fa	ax: 206-768	3-6266	
Seattle, Washington 98134		E-	-Mail: <u>Mari</u> d	on.Trigg@saint-gobain.com	
Test Contractor: Horizon Engineering		Ţ	est Contra	ctor Contact Information	
		Na	ame: David	l Bagwell	
Test Contractor Mailing Address:		Pi	none: 503-	255-5050	
13585 NE Whitaker Way		Fa	ax: 503-255	5-0505	
Portland, Oregon 97230				well@horizonengineering.com	
Testing Dates:					<u> </u>
Emission Unit	Pollutant Tested		ethod(s) be used)	Purpose for the Test (see Note below)	:
Glass Melting Furnace No. 5, Cloud Chamber Inlet	chrome	EPA 1, 2 29	, 3/3A, 4,	40 CFR Part 63, Subpart SS	SSSS
	_				
	_				
Any Test Method Deviations?	Attachments to	this Notif	ication? x	Yes (list below) No	
Yes (attach explanation) x No	Test plan				
Written Test Plan Required?			-		
x Yes No Unknown					
Person Submitting Notification:		•	Affiliati	on:	
David Bagwell			Horizon	n Engineering	76

David Bagwell

From: Gerry Pade [GerryP@pscleanair.org]

Sent: Monday, March 08, 2010 2:06 PM

To: Browning, Jayne E.

Cc: David Bagwell; Trigg, Marlon; Tom Hudson

Subject: RE: Seattle Furnace 5

Jayne Browning Saint-Gobain

Dear Ms. Browning,

I received the test plan and notification on 3/2/10. The failure to provide this information 60 days prior to the test is a violation of 40 CFR 63.7(b)(1) and the failure to request an audit sample 30 days prior to the test is a violation of Section 63.7(c)(4). However, I understand that Saint-Gobain needs a basis for certifying compliance with the chromium emission limit for the Tabasco bottle production run. I also understand that the production run will last only one week and that it wasn't possible to provide even the 21 days advance notice required under Section 3.07 of PSCAA Regulation I (AOP term.V.N.1).

Due to the abbreviated notification, inspectors Hudson and McAfee are unable to observe the test. Instead, I will be accompanied by their supervisor, Mario Pedroza.

Please note that the final test report needs to be accompanied by a Notification of Compliance Status per Section 63.11456(b). And as with furnace 3, which was producing antique green during its test, a re-test will be required if and when the furnace produces glass with a higher chromium content. If you have any questions, please contact me.

Gerry Pade, Engineer Puget Sound Clean Air Agency 1904 3rd Ave Ste 105 Seattle WA 98101-3317 (206) 689-4065 gerryp@pscleanair.org

"Working together for clean air"

o_ _/> (*)\(*)

From: Browning, Jayne E. [mailto:Jayne.E.Browning@saint-gobain.com]

Sent: Monday, March 01, 2010 1:51 PM

To: Gerry Pade Cc: David Bagwell

Subject: Seattle Furnace 5

Gerry,

I learned over the weekend that Seattle Furnace #5 is now scheduled for a short production run of

green glass that is potentially subject to the Glass NESHAP at 40 CFR Part 63, Subpart 6S. The run is scheduled to begin March 10, so SGCI is working with Horizon Engineering to schedule a source test on March 11, 2010. Horizon is preparing the official stack testing notification and will submit it to you very soon.

The stack testing notification will provide additional information, but I want to note two aspects of the stack testing. First, the test sampling will take place prior to the TriMer control device to demonstrate that Furnace #5 can meet the 0.02 lb/ton HAP emission limit without relying on additional emission reductions provided by the TriMer system.

Second, due to the small Tabasco bottle manufactured during this green glass production run, the anticipated draw rate will be approximately 75 tons/day. While this production rate is less than 50% of the overall furnace capacity, the March 11 green glass production still conservatively represents the maximum chromium emissions for comparison against the 0.02 lb/ton limit. Given the "lb/ton" unit for the Subpart 6S emission limit, the amount of the draw rate is less important than when comparing emissions against a lb/hr or ton/year emission threshold.

Although I am on the road at the moment, I am monitoring e-mails and have intermittent cell phone coverage. Please contact me if you have any questions.

Jayne Browning

Saint-Gobain Containers, Inc.

1509 S. Macedonia Ave., PO Box 4200

Muncie, IN 47307-4200 Phone: 765-741-7112 Fax: 765-741-4846 Cell: 765-744-1127

E-mail: lavne.e.browning@saint-gobaln.com

⊈ 4. Part 63 is amended by adding subpart SSSSSS to read as follows:

Subpart SSSSS—National Emission Standards for Hazardous Air Pollutants for Glass Manufacturing Area Sources

Applicability and Compliance Dates

63.11448 Am I subject to this subpart? 63.11449 What parts of my plant does this subpart cover?

63.11450 What are my compliance dates?

Standards, Compliance, and Monitoring Requirements

63.11451 What are the standards for new and existing sources?

63.11452 What are the performance test requirements for new and existing sources?

63.11453 What are the initial compliance demonstration requirements for new and existing sources?

63.11454 What are the monitoring requirements for new and existing sources?

63.11455 What are the continuous compliance requirements for new and existing sources?

Notifications and Records

63.11456 What are the notification requirements?

63.11457 What are the recordkeeping requirements?

Other Requirements and Information

63.11458 What General Provisions apply to this subpart?

63.11459 What definitions apply to this subpart?

63.11460 Who implements and enforces this subpart?

63.11461 [Reserved]

Tables to Subpart SSSSS of Part 63

Table 1 to Subpart SSSSSS of Part 63— Emission Limits

Table 2 to Subpart SSSSS of Part 63— Applicability of General Provisions to Subpart SSSSS

Applicability and Compliance Dates

§ 63.11448 Am I subject to this subpart?

You are subject to this subpart if you own or operate a glass manufacturing facility that is an area source of hazardous air pollutant (HAP) emissions and meets all of the criteria specified in paragraphs (a) through (c) of this section.

(a) A glass manufacturing facility is a plant site that manufactures flat glass, glass containers, or pressed and blown glass by melting a mixture of raw materials, as defined in § 63.11459, to produce molten glass and form the molten glass into sheets, containers, or other shapes.

(b) An area source of HAP emissions is any stationary source or group of stationary sources within a contiguous area under common control that does not have the potential to emit any single HAP at a rate of 9.07 megagrams per year (Mg/yr) (10 tons per year (tpy)) or more and any combination of HAP at a rate of 22.68 Mg/yr (25 tpy) or more.

(c) Your glass manufacturing facility uses one or more continuous furnaces to produce glass that contains compounds of one or more glass manufacturing metal HAP, as defined in § 63.11459, as raw materials in a glass manufacturing batch formulation.

§ 63.11449 What parts of my plant does this subpart cover?

(a) This subpart applies to each existing or new affected glass melting furnace that is located at a glass manufacturing facility and satisfies the requirements specified in paragraphs (a)(1) through (3) of this section.

 The furnace is a continuous furnace, as defined in § 63.11459.

(2) The furnace is charged with compounds of one or more glass manufacturing metal HAP as raw materials.

(3) The furnace is used to produce glass, which contains one or more of the glass menufacturing metal HAP as raw materials, at a rate of at least 45 Mg/yr (50 toy).

(b) A furnace that is a research and development process unit, as defined in § 63.11459, is not an affected furnace

under this subpart.

(c) An affected source is an existing source if you commenced construction or reconstruction of the affected source on or before September 20, 2007.

(d) An affected source is a new source if you commenced construction or reconstruction of the affected source after September 20, 2007.

(e) If you own or operate an area source subject to this subpart, you must obtain a permit under 40 CFR part 70 or 40 CFR part 71.

§ 63.11450 What are my compliance dates?

(a) If you have an existing affected source, you must comply with the applicable emission limits specified in § 63.11451 of this subpart no later than December 28, 2009. As specified in section 112(i)(3)(B) of the Clean Air Act and in § 63.6(i)(4)(A), you may request that the Administrator or delegated authority grant an extension allowing up to 1 additional year to comply with the applicable emission limits if such additional period is necessary for the installation of emission controls.

(b) If you have a new affected source, you must comply with this subpart according to paragraphs (b)(1) and (2) of this section.

(1) If you start up your affected source on or before December 26, 2007, you

must comply with the applicable emission limit specified in § 63.11451 no later than December 26, 2007.

(2) If you start up your affected source after December 26, 2007, you must comply with the applicable emission limit specified in § 63.11451 upon initial startup of your affected source.

(c) If you own or operate a furnace that produces glass containing one or more glass manufacturing metal HAP as raw materials at an annual rate of less than 45 Mg/yr (50 tpy), and you increase glass production for that furnace to an annual rate of at least 45 Mg/yr (50 tpy), you must comply with the applicable emission limit specified in § 63.11451 within 2 years of the date on which you increased the glass production rate for the furnace to at least 45 Mg/yr (50 tpy).

(d) If you own or operate a furnace that produces glass at an annual rate of at least 45 Mg/yr (50 tpy) and is not charged with glass manufacturing metal HAP, and you begin production of a glass product that includes one or more glass manufacturing metal HAP as raw materials, and you produce at least 45 Mg/yr (50 tpy) of this glass product, you must comply with the applicable emission limit specified in § 63.11451 within 2 years of the date on which you introduced production of the glass product that contains glass manufacturing metal HAP.

(e) You must meet the notification requirements in § 63.11456 according to the schedule in § 63.11456 and in 40 CFR part 63, subpart A. Some of the notifications must be submitted before you are required to comply with emission limits specified in this subpart.

Standards, Compliance, and Monitoring Requirements

§ 63.11451 What are the standards for new and existing sources?

If you are an owner or operator of an affected furnace, as defined in § 63.11449(a), you must meet the applicable emission limit specified in Table 1 to this subpart.

§ 63.11452 What are the performance test requirements for new and existing sources?

(a) If you own or operate an affected furnace that is subject to an emission limit specified in Table 1 to this subpart, you must conduct a performance test according to paragraphs (a)(1) through (3) and paragraph (b) of this section.

(1) For each affected furnace, you must conduct a performance test within 180 days after your compliance date and report the results in your Notification of Compliance Status, except as specified in paragraph (a)(2) of this section.

79

- 73202
- (2) You are not required to conduct a performance test on the affected furnace if you satisfy the conditions described in paragraphs (a)(2)(i) through (iii) of this section.
- (i) You conducted a performance test on the affected furnace within the past 5 years of the compliance date using the same test methods and procedures specified in paragraph (b) of this section.
- (ii) The performance test demonstrated that the affected furnace met the applicable emission limit specified in Table 1 to this subpart.
- (iii) Either no process changes have been made since the test, or you can demonstrate that the results of the performance test, with or without adjustments, reliably demonstrate compliance with the applicable emission limit.
- (3) If you operate multiple identical furnaces, as defined in § 63.11459, that are affected furnaces, you are required to test only one of the identical furnaces if you meet the conditions specified in paragraphs (a)(3)(i) through (iii) of this section.
- (i) You must conduct the performance test while the furnace is producing glass that has the greatest potential to emit the glass manufacturing metal HAP from among the glass formulations that are used in any of the identical furnaces.
- (ii) You certify in your Notification of Compliance Status that the identical furnaces meet the definition of identical furnaces specified in § 63.11459.
- (iii) You provide in your Notification of Compliance Status documentation that demonstrates why the tested glass formulation has the greatest potential to emit the glass manufacturing metal HAP.
- (b) You must conduct each performance test according to the requirements in § 63.7 and paragraphs (b)(1) through (12) and either paragraph (b)(13) or (b)(14) of this section.
- Install and validate all monitoring equipment required by this subpart before conducting the performance test.
- (2) You may not conduct performance tests during periods of startup, shutdown, or malfunction, as specified in § 63.7(e)(1).
- (3) Conduct the test while the source is operating at the maximum production rate.
- (4) Conduct at least three separate test runs with a minimum duration of 1 hour for each test run, as specified in § 63.7(e)(3).
 - (5) Record the test date.
- (6) Identify the emission source tested.

- (7) Collect and record the emission test data listed in this section for each run of the performance test.
- (8) Locate all sampling sites at the outlet of the furnace control device or at the furnace stack prior to any releases to the atmosphere.
- (9) Select the locations of sampling ports and the number of traverse points using Method 1 or 1A of 40 CFR part 60, appendix A-1.
- (10) Measure the gas velocity and volumetric flow rate using Method 2, 2A, 2C, 2F, or 2G of 40 CFR part 60, appendices A-1 and A-2, during each test run.
- (11) Conduct gas molecular weight analysis using Methods 3, 3A, or 3B of 40 CFR part 60, appendix A-2, during each test run. You may use ANSI/ASME PTC 19.10–1981, Flue and Exhaust Gas Analyses (incorporated by reference—see § 63.14) as an alternative to EPA Method 3B.
- (12) Measure gas moisture content using Method 4 of 40 CFR part 60, appendix A-3, during each test run.
- (13) To meet the particulate matter (PM) emission limit specified in Table 1 to this subpart, you must conduct the procedures specified in paragraphs (b)(13)(i) through (v) of this section.
- (i) Measure the PM mass emission rate at the outlet of the control device or at the stack using Method 5 or 17 of 40 CFR part 60, appendices A-3 or A-6, for each test run.
- (ii) Calculate the PM mass emission rate in the exhaust stream for each test run.
- (iii) Measure and record the glass production rate (kilograms (tons) per hour of product) for each test run.
- (iv) Calculate the production-based PM mass emission rate (g/kg (lb/ton)) for each test run using Equation 1 of this section.

$$MP = \frac{ER}{P}$$
 (Equation 1)

Where:

- MP = Production-based PM mass emission rate, grams of PM per kilogram (pounds of PM per ton) of glass produced.
- ER = PM mass emission rate measured using Methods 5 or 17 during each performance test run, grams (pounds) per hour.
- P = Average glass production rate for the performance test, kilograms (tons) of glass produced per hour.
- (v) Calculate the 3-hour block average production-based PM mass emission rate as the average of the production-based PM mass emission rates for each test run.
- (14) To meet the metal HAP emission limit specified in Table 1 to this

- subpart, you must conduct the procedures specified in paragraphs (b)(14)(i) through (v) of this section.
- (i) Measure the metal HAP mass emission rate at the outlet of the control device or at the stack using Method 29 of 40 CFR part 60, appendix A-8, for each test run.
- (ii) Calculate the metal HAP mass emission rate in the exhaust stream for the glass manufacturing metal HAP that are added as raw materials to the glass manufacturing formulation for each test run.
- (iii) Measure and record the glass production rate (kilograms (tons) per hour of product) for each test run.
- (iv) Calculate the production-based metal HAP mass emission rate (g/kg (lb/ ton)) for each test run using Equation 2 of this section.

$$MPM = \frac{ERM}{P}$$
 (Equation 2)

Where

MPM = Production-based metal HAP mass emission rate, grams of metal HAP per kilogram (pounds of metal HAP per ton) of glass produced.

- ERM = Sum of the metal HAP mass emission rates for the glass manufacturing metal HAP that are added as raw materials to the glass manufacturing formulation and are measured using Method 29 during each performance test run, grams (pounds) per hour.
- P = Average glass production rate for the performance test, kilograms (tons) of glass produced per hour.
- (v) Calculate the 3-hour block average production-based metal HAP mass emission rate as the average of the production-based metal HAP mass emission rates for each test run.

§ 63.11453 What are the initial compliance demonstration requirements for new and existing sources?

- (a) If you own or operate an affected source, you must submit a Notification of Compliance Status in accordance with §§ 63.9(h) and 63.11456(b).
- (b) For each existing affected furnace that is subject to the emission limits specified in Table 1 to this subpart, you must demonstrate initial compliance according to the requirements in paragraphs (b)(1) through (4) of this section.
- (1) For each fabric filter that is used to meet the emission limit specified in Table 1 to this subpart, you must visually inspect the system ductwork and fabric filter unit for leaks. You must also inspect the inside of each fabric filter for structural integrity and fabric filter condition. You must record the results of the inspection and any maintenance action as required in § 63.11457(a)(6).

(2) For each electrostatic precipitator (ESP) that is used to meet the emission limit specified in Table 1 to this subpart, you must verify the proper functioning of the electronic controls for corona power and rapper operation, that the corona wires are energized, and that adequate air pressure is present on the rapper manifold. You must also visually inspect the system ductwork and ESP housing unit and hopper for leaks and inspect the interior of the ESP to determine the condition and integrity of corona wires, collection plates, hopper, and air diffuser plates. You must record the results of the inspection and any maintenance action as required in § 63.11457(a)(6).

(3) You must conduct each inspection specified in paragraphs (b)(1) and (2) of this section no later than 60 days after your applicable compliance date specified in § 63.11450, except as specified in paragraphs (b)(3)(i) and (ii)

of this section.

(i) An initial inspection of the internal components of a fabric filter is not required if an inspection has been performed within the past 12 months.

(ii) An initial inspection of the internal components of an ESP is not required if an inspection has been performed within the past 24 months.

(4) You must satisfy the applicable requirements for performance tests

specified in § 63.11452.

(c) For each new affected furnace that is subject to the emission limit specified in Table 1 to this subpart and is controlled with a fabric filter, you must install, operate, and maintain a bag leak detection system according to paragraphs (c)(1) through (3) of this section.

(1) Each bag leak detection system must meet the specifications and requirements in paragraphs (c)(1)(i)

through (viii) of this section.

(i) The bag leak detection system must be certified by the manufacturer to be capable of detecting PM emissions at concentrations of 1 milligram per dry standard cubic meter (0.00044 grains per actual cubic foot) or less.

(ii) The bag leak detection system sensor must provide output of relative PM loadings. The owner or operator shall continuously record the output from the bag leak detection system using electronic or other means (e.g., using a strip chart recorder or a data logger).

(iii) The bag leak detection system must be equipped with an alarm system that will sound when the system detects an increase in relative particulate loading over the alarm set point established according to paragraph (c)(1)(iv) of this section, and the alarm must be located such that it can be

heard by the appropriate plant personnel.

(iv) In the initial adjustment of the bag leak detection system, you must establish, at a minimum, the baseline output by adjusting the sensitivity (range) and the averaging period of the device, the alarm set points, and the alarm delay time.

(v) Following initial adjustment, you shall not adjust the averaging period, alarm set point, or alarm delay time without approval from the Administrator or delegated authority except as provided in paragraph

(c)(1)(vi) of this section.

(vi) Once per quarter, you may adjust the sensitivity of the bag leak detection system to account for seasonal effects, including temperature and humidity, according to the procedures identified in the site-specific monitoring plan required by paragraph (c)(2) of this section.

(vii) You must install the bag leak detection sensor downstream of the

fabric filter.

(viii) Where multiple detectors are required, the system's instrumentation and alarm may be shared among detectors.

(2) You must develop and submit to the Administrator or delegated authority for approval a site-specific monitoring plan for each bag leak detection system. You must operate and maintain the bag leak detection system according to the site-specific monitoring plan at all times. Each monitoring plan must describe the items in paragraphs (c)(2)(i) through (vi) of this section.

(i) Installation of the bag leak

detection system;

(ii) Initial and periodic adjustment of the bag leak detection system, including how the alarm set-point will be established;

(iii) Operation of the bag leak detection system, including quality

assurance procedures;

 (iv) How the bag leak detection system will be maintained, including a routine maintenance schedule and spare parts inventory list;

 (v) How the bag leak detection system output will be recorded and stored; and

(vi) Corrective action procedures as specified in paragraph (c)(3) of this section. In approving the site-specific monitoring plan, the Administrator or delegated authority may allow owners and operators more than 3 hours to alleviate a specific condition that causes an alarm if the owner or operator identifies in the monitoring plan this specific condition as one that could lead to an alarm, adequately explains why it is not feasible to alleviate this condition within 3 hours of the time the alarm

occurs, and demonstrates that the requested time will ensure alleviation of this condition as expeditiously as

(3) For each bag leak detection system, you must initiate procedures to determine the cause of every alarm within 1 hour of the alarm. Except as provided in paragraph (c)(2)(vi) of this section, you must alleviate the cause of the alarm within 3 hours of the alarm by taking whatever corrective action(s) are necessary. Corrective actions may include, but are not limited to the following:

 (i) Inspecting the fabric filter for air leaks, torn or broken bags or filter media, or any other condition that may cause an increase in PM emissions;

(ii) Sealing off defective bags or filter

media;

- (iii) Replacing defective bags or filter media or otherwise repairing the control device;
- (iv) Sealing off a defective fabric filter compartment;
- (v) Cleaning the bag leak detection system probe or otherwise repairing the bag leak detection system; or

(vi) Shutting down the process producing the PM emissions.

- (d) For each new affected furnace that is subject to the emission limit specified in Table 1 to this subpart and is controlled with an ESP, you must install, operate, and maintain according to the manufacturer's specifications, one or more continuous parameter monitoring systems (CPMS) for measuring and recording the secondary voltage and secondary electrical current to each field of the ESP according to paragraphs (d)(1) through (13) of this section.
- (1) The CPMS must have an accuracy of 1 percent of the secondary voltage and secondary electrical current, or better.
- (2) Your CPMS must be capable of measuring the secondary voltage and secondary electrical current over a range that extends from a value that is at least 20 percent less than the lowest value that you expect your CPMS to measure, to a value that is at least 20 percent greater than the highest value that you expect your CPMS to measure.

(3) The signal conditioner, wiring, power supply, and data acquisition and recording system of your CPMS must be compatible with the output signal of the

sensors used in your CPMS.

(4) The data acquisition and recording system of your CPMS must be able to record values over the entire range specified in paragraph (d)(2) of this section.

(5) The data recording system associated with your CPMS must have

a resolution of one-half of the required overall accuracy of your CPMS, as specified in paragraph (d)(1) of this

section, or better.

(6) Your CPMS must be equipped with an alarm system that will sound when the system detects a decrease in secondary voltage or secondary electrical current below the alarm set point established according to paragraph (d)(7) of this section, and the alarm must be located such that it can be heard by the appropriate plant personnel.

(7) In the initial adjustment of the CPMS, you must establish, at a minimum, the baseline output by adjusting the sensitivity (range) and the averaging period of the device, the alarm set points, and the alarm delay

time.

(8) You must install each sensor of the CPMS in a location that provides representative measurement of the appropriate parameter over all operating conditions, taking into account the manufacturer's guidelines.

(9) You must perform an initial calibration of your CPMS based on the

procedures specified in the

manufacturer's owner's manual.
(10) Your CPMS must be designed to complete a minimum of one cycle of operation for each successive 15-minute period. To have a valid hour of data, you must have at least three of four equally-spaced data values (or at least 75 percent of the total number of values if you collect more than four data values per hour) for that hour (not including startup, shutdown, malfunction, or out of control periods).

(11) You must record valid data from at least 90 percent of the hours during which the affected source or process

operates.

(12) You must record the results of each inspection, calibration, initial validation, and accuracy audit.

(13) At all times, you must maintain your CPMS including, but not limited to, maintaining necessary parts for routine repairs of the CPMS.

- (e) For each new affected furnace that is subject to the emission limit specified in Table 1 to this subpart and is controlled by a device other than a fabric filter or an ESP, you must prepare and submit a monitoring plan to EPA or the delegated authority for approval. Each plan must contain the information in paragraphs (e)(1) through (5) of this section.
- (1) A description of the device; (2) Test results collected in accordance with § 63.11452 verifying the performance of the device for reducing PM or metal HAP to the levels required by this subpart;

(3) Operation and maintenance plan for the control device (including a preventative maintenance schedule consistent with the manufacturer's instructions for routine and long-term maintenance) and continuous monitoring system;

(4) A list of operating parameters that will be monitored to maintain continuous compliance with the applicable emission limits; and

(5) Operating parameter limits based on monitoring data collected during the performance test.

§63.11454 What are the monitoring requirements for new and existing sources?

(a) For each monitoring system required by this subpart, you must install, calibrate, operate, and maintain the monitoring system according to the manufacturer's specifications and the requirements specified in paragraphs (a)(1) through (7) of this section.

(1) You must install each sensor of your monitoring system in a location that provides representative measurement of the appropriate parameter over all operating conditions, taking into account the manufacturer's

guidelines.

(2) You must perform an initial calibration of your monitoring system based on the manufacturer's recommendations.

(3) You must use a monitoring system that is designed to complete a minimum of one cycle of operation for each successive 15-minute period.

(4) For each existing affected furnace, you must record the value of the monitored parameter at least every 8 hours. The value can be recorded electronically or manually.

(5) You must record the results of each inspection, calibration, monitoring system maintenance, and corrective action taken to return the monitoring

system to normal operation.

(6) At all times, you must maintain your monitoring system including, but not limited to, maintaining necessary parts for routine repairs of the system.

- (7) You must perform the required monitoring whenever the affected furnace meets the conditions specified in paragraph (a)(7)(i) or (ii) of this section.
- (i) The furnace is being charged with one or more of the glass manufacturing metal HAP as raw materials.
- (ii) The furnace is in transition between producing glass that contains one or more of the glass metal HAP as raw materials and glass that does not contain any of the glass manufacturing metal HAP as raw materials. The transition period begins when the furnace is charged with raw materials

that do not contain any of the glass manufacturing metal HAP as raw materials and ends when the furnace begins producing a saleable glass product that does not contain any of the glass manufacturing metal HAP as raw materials.

(b) For each existing furnace that is subject to the emission limit specified in Table 1 to this subpart and is controlled with an ESP, you must meet the requirements specified in paragraphs

(b)(1) or (2) of this section.

(1) You must monitor the secondary voltage and secondary electrical current to each field of the ESP according to the requirements of paragraph (a) of this section, or

(2) You must submit a request for alternative monitoring, as described in

paragraph (g) of this section.

(c) For each existing furnace that is subject to the emission limit specified in Table 1 to this subpart and is controlled with a fabric filter, you must meet the requirements specified in paragraphs (c)(1) or (2) of this section.

(1) You must monitor the inlet temperature to the fabric filter according to the requirements of paragraph (a) of

this section, or

(2) You must submit a request for alternative monitoring, as described in

paragraph (g) of this section.

(d) For each new furnace that is subject to the emission limit specified in Table 1 to this subpart and is controlled with an ESP, you must monitor the voltage and electrical current to each field of the ESP on a continuous basis using one or more CPMS according to the requirements for CPMS specified in § 63.11453(d).

(e) For each new furnace that is subject to the emission limit specified in Table 1 to this subpart and is controlled with a fabric filter, you must install and operate a bag leak detection system according to the requirements specified

in § 63.11453(c).

(f) For each new or existing furnace that is subject to the emission limit specified in Table 1 to this subpart and is equipped with a control device other than an ESP or fabric filter, you must meet the requirements in § 63.8(f) and submit a request for approval of alternative monitoring methods to the Administrator no later than the submittal date for the Notification of Compliance Status, as specified in § 63.11456(b). The request must contain the information specified in paragraphs (f)(1) through (5) of this section.

(1) Description of the alternative addon air pollution control device (APCD).

(2) Type of monitoring device or method that will be used, including the sensor type, location, inspection

procedures, quality assurance and quality control (QA/QC) measures, and data recording device.

(3) Operating parameters that will be monitored.

(4) Frequency that the operating parameter values will be measured and recorded.

(5) Procedures for inspecting the condition and operation of the control device and monitoring system.

- (g) If you wish to use a monitoring method other than those specified in paragraph (b)(1) or (c)(1) of this section, you must meet the requirements in § 63.8(f) and submit a request for approval of alternative monitoring methods to the Administrator no later than the submittal date for the Notification of Compliance Status, as specified in § 63.11456(b). The request must contain the information specified in paragraphs (g)(1) through (5) of this section.
- (1) Type of monitoring device or method that will be used, including the sensor type, location, inspection procedures, QA/QC measures, and data recording device.

(2) Operating parameters that will be monitored.

(3) Frequency that the operating parameter values will be measured and recorded.

(4) Procedures for inspecting the condition and operation of the monitoring system.

(5) Explanation for how the alternative monitoring method will provide assurance that the emission control device is operating properly.

§ 63.11455 What are the continuous compliance requirements for new and existing sources?

(a) You must be in compliance with the applicable emission limits in this subpart at all times, except during periods of startup, shutdown, and malfunction.

(b) You must always operate and maintain your affected source, including air pollution control and monitoring equipment, according to the provisions

in § 63.6(e)(1)(i).

(c) For each affected furnace that is subject to the emission limit specified in Table 1 to this subpart, you must monitor the performance of the furnace emission control device under the conditions specified in § 63.11454(a)(7) and according to the requirements in §§ 63.6(e)(1) and 63.8(c) and paragraphs (c)(1) through (6) of this section.

(1) For each existing effected furnace that is controlled with an ESP, you must monitor the parameters specified in § 63.11454(b) in accordance with the requirements of § 63.11454(a) or as

specified in your approved alternative monitoring plan.

(2) For each new affected furnace that is controlled with an ESP, you must comply with the monitoring requirements specified in § 63.11454(d) in accordance with the requirements of § 63.11454(a) or as specified in your approved alternative monitoring plan.

(3) For each existing affected furnace that is controlled with a fabric filter, you must monitor the parameter specified in § 63.11454(c) in accordance with the requirements of § 63.11454(a) or as specified in your approved alternative

monitoring plan.

(4) For each new affected furnace that is controlled with a fabric filter, you must comply with the monitoring requirements specified in § 63.11454(e) in accordance with the requirements of § 63.11454(a) or as specified in your approved alternative monitoring plan.

(5) For each affected furnace that is controlled with a device other than a fabric filter or ESP, you must comply with the requirements of your approved alternative monitoring plan, as required

in § 63.11454(g).

(6) For each monitoring system that is required under this subpart, you must keep the records specified in § 63.11457.

(d) Following the initial inspections, you must perform periodic inspections and maintenance of each affected furnace control device according to the requirements in paragraphs (d)(1) through (4) of this section.

(1) For each fabric filter, you must conduct inspections at least every 12 months according to paragraphs (d)(1)(i)

through (iii) of this section.

 (i) You must inspect the ductwork and fabric filter unit for leakage.

(ii) You must inspect the interior of the fabric filter for structural integrity and to determine the condition of the fabric filter.

(iii) If an initial inspection is not required, as specified in § 63.11453(b)(3)(i), the first inspection must not be more than 12 months from the last inspection.

(2) For each ESP, you must conduct inspections according to the requirements in paragraphs (d)(2)(i) through (iii) of this section.

(i) You must conduct visual inspections of the system ductwork, housing unit, and hopper for leaks at least every 12 months.

(ii) You must conduct inspections of the interior of the ESP to determine the condition and integrity of corona wires, collection plates, plate rappers, hopper, and air diffuser plates every 24 months.

(iii) If an initial inspection is not required, as specified in § 63.11453(b)(3)(ii), the first inspection

- must not be more than 24 months from the last inspection.
- (3) You must record the results of each periodic inspection specified in this section in a logbook (written or electronic format), as specified in § 63.11457(c).
- (4) If the results of a required inspection indicate a problem with the operation of the emission control system, you must take immediate corrective action to return the control device to normal operation according to the equipment manufacturer's specifications or instructions.
- (e) For each affected furnace that is subject to the emission limit specified in Table 1 to this subpart and can meet the applicable emission limit without the use of a control device, you must demonstrate continuous compliance by satisfying the applicable recordkeeping requirements specified in § 63.11457.

Notifications and Records

§ 63.11456 What are the notification requirements?

- (a) If you own or operate an affected furnace, as defined in §63.11449(a), you must submit an Initial Notification in accordance with §63.9(b) and paragraphs (a)(1) and (2) of this section by the dates specified.
- (1) As specified in § 63.9(b)(2), if you start up your affected source before December 26, 2007, you must submit an Initial Notification not later than April 24, 2008 or within 120 days after your affected source becomes subject to the standard
- (2) The Initial Notification must include the information specified in § 63.9(b)(2)(i) through (iv).
- (b) You must submit a Notification of Compliance Status in accordance with § 63.9(h) and the requirements in paragraphs (b)(1) and (2) of this section.
- (1) If you own or operate an affected furnace and are required to conduct a performance test, you must submit a Notification of Compliance Status, including the performance test results, before the close of business on the 60th day following the completion of the performance test, according to § 60.8 or § 63.10(d)(2).
- (2) If you own or operate an affected furnace and satisfy the conditions specified in § 63.11452(a)(2) and are not required to conduct a performance test, you must submit a Notification of Compliance Status, including the results of the previous performance test, before the close of business on the compliance date specified in § 63.11450.

83

§ 63.11457 What are the recordkeeping requirements?

(a) You must keep the records specified in paragraphs (a)(1) through

(8) of this section.

(1) A copy of any Initial Notification and Notification of Compliance Status that you submitted and all documentation supporting those notifications, according to the requirements in § 63.10(b)(2)(xiv).

(2) The records specified in § 63.10(b)(2) and (c)(1) through (13).

(3) The records required to show continuous compliance with each emission limit that applies to you, as

specified in § 63.11455.

(4) For each affected source, records of production rate on a process throughput basis (either feed rate to the process unit or discharge rate from the process unit). The production data must include the amount (weight or weight percent) of each ingredient in the batch formulation, including all glass manufacturing metal HAP compounds.

(5) Records of maintenance activities and inspections performed on control devices as specified in §§ 63.11453(b) and 63.11455(d), according to paragraphs (a)(5)(i) through (v) of this

section.

(i) The date, place, and time of inspections of control device ductwork, interior, and operation.

(ii) Person conducting the inspection. (iii) Technique or method used to

conduct the inspection.

(iv) Control device operating conditions during the time of the inspection.

(v) Results of the inspection and description of any corrective action

(6) Records of all required monitoring data and supporting information including all calibration and maintenance records.

(7) For each bag leak detection system, the records specified in paragraphs (a)(7)(i) through (iii) of this section.

(i) Records of the bag leak detection

system output;

(ii) Records of bag leak detection system adjustments, including the date and time of the adjustment, the initial bag leak detection system settings, and the final bag leak detection system

settings; and

(iii) The date and time of all bag leak detection system alarms, the time that procedures to determine the cause of the alarm were initiated, the cause of the alarm, an explanation of the actions taken, the date and time the cause of the alarm was alleviated, and whether the alarm was alleviated within 3 hours of the alarm.

(8) Records of any approved alternative monitoring method(s) or test procedure(s).

(b) Your records must be in a form suitable and readily available for expeditious review, according to

§ 63.10(b)(1).

(c) You must record the results of each inspection and maintenance action in a logbook (written or electronic format). You must keep the logbook onsite and make the logbook available to the permitting authority upon request.

(d) As specified in § 63.10(b)(1), you must keep each record for a minimum of 5 years following the date of each occurrence, measurement, maintenance, corrective action, report, or record.

You must keep each record onsite for at least 2 years after the date of each occurrence, measurement, maintenance, corrective action, report, or record, according to § 63.10(b)(1). You may keep the records offsite for the remaining three years.

Other Requirements and Information

§ 63.11458 What General Provisions apply to this subpart?

You must satisfy the requirements of the General Provisions in 40 CFR part 63, subpart A, as specified in Table 2 to this subpart.

§ 63.11459 What definitions apply to this subpart?

Terms used in this subpart are defined in the Clean Air Act, in § 63.2, and in this section as follows:

Air pollution control device (APCD) means any equipment that reduces the quantity of a pollutant that is emitted to the air.

Continuous furnace means a glass manufacturing furnace that operates continuously except during periods of maintenance, malfunction, control device installation, reconstruction, or rebuilding.

Cullet means recycled glass that is mixed with raw materials and charged to a glass melting furnace to produce glass. Cullet is not considered to be a raw material for the purposes of this

ubpart.

Electrostatic precipitator (ESP) means an APCD that removes PM from an exhaust gas stream by applying an electrical charge to particles in the gas stream and collecting the charged particles on plates carrying the opposite electrical charge.

Fabric filter means an APCD used to capture PM by filtering a gas stream

through filter media.

Furnace stack means a conduit or conveyance through which emissions from the furnace melter are released to the atmosphere.

Glass manufacturing metal HAP means an oxide or other compound of any of the following metals included in the list of urban HAP for the Integrated Urban Air Toxics Strategy and for which Glass Manufacturing was listed as an area source category: arsenic, cadmium, chromium, lead, manganese, and nickel.

Glass melting furnace means a unit comprising a refractory-lined vessel in which raw materials are charged and melted at high temperature to produce

molten glass.

Identical furnaces means two or more furnaces that are identical in design, including manufacturer, dimensions, production capacity, charging method, operating temperature, fuel type, burner configuration, and exhaust system

configuration and design.

Particulate matter (PM) means, for purposes of this subpart, emissions of PM that serve as a measure of filterable particulate emissions, as measured by Methods 5 or 17 (40 CFR part 60, appendices A-3 and A-6), and as a surrogate for glass manufacturing metal HAP compounds contained in the PM including, but not limited to, arsenic, cadmium, chromium, lead, manganese, and nickel.

Plant site means all contiguous or adjoining property that is under common control, including properties that are separated only by a road or other public right-of-way. Common control includes properties that are owned, leased, or operated by the same entity, parent entity, subsidiary, or any

combination thereof.

Raw material means minerals, such as silica sand, limestone, and dolomite; inorganic chemical compounds, such as soda ash (sodium carbonate), salt cake (sodium sulfate), and potash (potassium carbonate); metal oxides and other metal-based compounds, such as lead oxide, chromium oxide, and sodium antimonate; metal ores, such as chromite and pyrolusite; and other substances that are intentionally added to a glass manufacturing batch and melted in a glass melting furnace to produce glass. Metals that are naturallyoccurring trace constituents or contaminants of other substances are not considered to be raw materials. Cullet and material that is recovered from a furnace control device for recycling into the glass formulation are not considered to be raw materials for the purposes of this subpart.

Research and development process unit means a process unit whose purpose is to conduct research and development for new processes and products and is not engaged in the manufacture of products for commercial sale, except in a de minimis manner \$4

§ 63.11460 Who implements and enforces this subpart?

- (a) This subpart can be implemented and enforced by the U.S. EPA, or a delegated authority such as your State, local, or tribal agency. If the U.S. EPA Administrator has delegated authority to your State, local, or tribal agency, then that agency has the authority to implement and enforce this subpart. You should contact your U.S. EPA Regional Office to find out if this subpart is delegated to your State, local, or tribal agency.
- (b) In delegating implementation and enforcement authority of this subpart to
- a State, local, or tribal agency under 40 CFR part 63, subpart E, the authorities contained in paragraphs (b)(1) through (4) of this section are retained by the Administrator of the U.S. EPA and are not transferred to the State, local, or tribal agency.
- (1) Approval of alternatives to the applicability requirements in §§ 63.11448 and 63.11449, the compliance date requirements in § 63.11450, and the emission limits specified in § 63.11451.
- (2) Approval of a major change to test methods under § 63.7(e)(2)(ii) and (f) and as defined in § 63.90.

- (3) Approval of major alternatives to monitoring under § 63.8(f) and as defined in § 63.90.
- (4) Approval of major alternatives to recordkeeping under § 63.10(f) and as defined in § 63.90.

§63.11461 [Reserved]

Tables to Subpart SSSSSS of Part 63

As required in § 63.11451, you must comply with each emission limit that applies to you according to the following table:

TABLE 1 TO SUBPART SSSSSS OF PART 63—EMISSION LIMITS

For each	You must meet one of the following emission limits
 New or existing glass melting furnace that produces glass at an annual rate of at least 45 Mg/yr (50 tpy) AND is charged with compounds of arsenic, cadmium, chromium, manganese, lead, or nickel as raw materials. 	must not exceed 0.1 gram per kilogram (g/kg) (0.2 pound per ton (lb/

As stated in § 63.11458, you must comply with the requirements of the NESHAP General Provisions (40 CFR part 63, subpart A), as shown in the following table:

TABLE 2 TO SUBPART SSSSS OF PART 63-APPLICABILITY OF GENERAL PROVISIONS TO SUBPART SSSSSS

Citation	Subject
§ 63.1(a), (b), (c)(1), (c)(2), (c)(5), (e)	Units and Abbreviations. Prohibited Activities. Construction/Reconstruction. Compliance with Standards and Maintenance Requirements. Performance Testing Requirements. Monitoring Requirements. Notification Requirements.
\$ 63.12	State Authority and Delegations. Addresses. Incorporations by Reference. Availability of Information. Performance Track Provisions.

■ 5. Part 63 is amended by adding subpart TTTTTT to read as follows:

Subpart TTTTT—National Emission Standards for Hazardous Air Pollutants for Secondary Nonferrous Metals Processing Area Sources

Applicability and Compliance Dates Sec.

63.11462 Am I subject to this subpart?
63.11463 What parts of my plant does this subpart cover?

63.11464 What are my compliance detes?

Standards, Compliance, and Monitoring Requirements

- 63.11465 What are the standards for new and existing sources?
- 63.11466 What are the performance test requirements for new and existing sources?
- 63.11467 What are the initial compliance demonstration requirements for new and existing sources?
- 63.11468 What are the monitoring requirements for new and existing sources?
- 63.11469 What are the notification requirements?

63.11470 What are the recordkeeping requirements?

Other Requirements and Information

- 63.11471 What General Provisions apply to this subpart?
- 63.11472 What definitions apply to this subpart?
- 63.11473 Who implements and enforces this subpart?
- 63.11474 [Reserved]

Tables to Subpart TTTTTT of Part 63

Table 1 to Subpart TTTTTT of Part 63—Applicability of General Provisions to Subpart TTTTTT 85

What Is The Compliance Date?

Existing Sources: December 28, 2009.

New Sources: Upon initial startup.

What Are The Permitting Requirements?

Affected facilities must obtain a Title V permit.

What Are The Impacts?

 Three glass plants are expected to have to add controls to comply with the rule.

What Records Are Required?

Reporting:

- Initial notification and notification of compliance status (may be combined), due 120 days after promulgation date
- Initial notification informs EPA that the facility is subject to the standards. Notification of compliance status provides certification of compliance with standards.
- No ongoing compliance reports to be required beyond Title V Requirements.

Recordkeeping:

- Records to include copies of notifications submitted to EPA, glass production data, and records of monitoring and inspections.
- Records to be maintained in a form-suitable and readily available for expeditious review.

You can also contact your Regional EPA air toxics office at the following numbers:

Address	States	Website/ Phone Number
Region 1 1 Congress Street Suite 1100 Boston, MA 02114-2023	CT, MA, ME, NH, RI, VT	www.epa.gov/region1 (888) 372-7341 (817) 918-1650
Region 2 290 Broadway New York, NY 10007-1866	NJ, NY, PR, VI	www.epa.gov/region2 (212) 637-4023
Region 3 1650 Arch Street Philadelphia, PA 19103-2029	DE, MD, PA, VA, WV, DC	www.epa.gov/region3 (800) 241-1754 (215) 814-2196
Region 4 Atlanta Federal Center 61 Forsyth Street, SW Allanta, GA 30303-8960	FL, NC, SC, KY, TN, GA, AL, MS	www.epa.gov/region4 (404) 562-8131
Region 5 77 West Jackson Blvd Chlcago, IL 60604-3507	IL, IN, MI, WI, MN, OH	www.epa.gov/region5 (312) 353-3575 (312) 353-4145 (312) 886-3850
Region 6 1445 Ross Avenue Sulle 1200 Dallas, TX 75202-2733	AR, LA, NM, OK, TX	www.epa.gov/region6 (800) 621-8431* 214-665-7171
Region 7 901 North Fifth Street Kansas City, KS 66101	IA, KS, MO, NE	www.epa.gov/region7 (800) 223-0425 (913) 551-7566
Region 8 1595 Wynkoop SL Denver, CO 80202-1129	CO, MT, ND, SD, UT, WY	www.epa.gov/reglon8 (800) 227-8917* (303) 312-6480
Region 9 75 Hawthome Street San Francisco, CA 94105	CA, AZ, HI, NV, GU, AS, MP	www.epa.gov/region9 (415) 744-1197
Region 10 1200 Slxth Ave Seattle, WA 98101	AK, ID, WA, OR	www.epa.gov/region10 (800) 424-4372* (206) 553-2117

^{*}For sources within the region only.

For More Information

Copies of the rule and other materials are located at : www.epa.gov/ttn/atw/area/arearules.html

United States Environmental Protection

December 2007

www.epa.gov/ttn/atw/eparules.html

Office of Air Quality Planning & Standards (El 43-02)



Summary of Regulations Controlling Air Emissions for the

GLASS MANUFACTURING INDUSTRY



NATIONAL EMISSION
STANDARDS FOR
HAZARDOUS AIR
POLLUTANTS
NESHAP
(SUBPART SSSSS)
FINAL RULE



GLASS MANUFACTURING (SUBPART SSSSS)

What Is An Area Source?

Any source that is not a major source. (A major source is a facility that emits, or has the potential to emit in the absence of controls, at least 10 tons per year (TPY) of individual hazardous air pollutants (HAP) or 25 TPY of combined HAP.)

Who Does This Rule Apply To?

 Facilities with glass manufacturing furnaces producing at least 50 tons of glass per year.

Who Is Subject To The Rule?

 Glass manufacturing plants with continuous furnaces that process urban HAP metals (As, Cd, Cr, Pb, Mn, Ni) as raw materials (not including trace materials in non-HAP raw materials such as sand).

What Am I Required To Do?

 All affected sources must meet one of two emissions limits. New and existing sources have different monitoring requirements.

The charts on the following pages explain, in detail, how all affected glass manufacturers can comply with the rule.

Initial testing requirement:

 One-time performance test on each furnace unless the furnace has been tested in the last 5 years and the previous test demonstrated compliance.

	Monitoring Requirements			
	Baghouse	ESP		
Existing	Inlet temperature monitoring: record every 15 minutes and record every 8 hours	ESP monitoring of the secondary voltage and secondary electrical current to each field of the ESP; measure every 15 minutes and record every 8 hours		
New	Leak detectors	Install CPMS to measure and record the secondary voltage and secondary current to each field of the ESP		
Sources	Annual inspections of furnace control devices			
All Sc				

Emission Limits			
Pollutant Emission Limit*			
Particulate Matter	0.2 lb/ton (0.1 g/kg)		
Combined Urban HAP (As, Cd, Cr, Pb, Mn, Ni)	0.02 lb/ton (0.01 g/kg)		

^{*} Pounds emitted per ton of glass produced. (Grams emitted per kilogram of glass produced.)



